

*20641

IRON 477-0269

Report of Survey for Repairs of Engines and Boilers.

No. in Book. Survey held at London Date, first Survey 24/2/71 Last Survey 24/2/71 18
on the Screw Steamer Yorkshire Master Longley
1771 Owners W. H. Indall & Co. Port belonging to London Classified 108A
2079
Diameter of Cylinder 36 1/2 Engines made at Kull When made 1891
Length of Stroke 36
Pressure of Steam 60 By whom made C. W. Earle
Registered Horse Power 250

Particulars of Repairs and Examination High pressure piston and both slide valves overhauled, Link gear overhauled and adjusted, Air & circulating pumps also valves and feed pumps overhauled, Crank shaft examined, Propeller ground loose on shaft, new keys fitted and keep strap fitted to tail key. All sea connections ground in.
Several new stays fitted to combustion chambers, and a few tubes renewed. Boilers tested under Superheater repaired by new plate being fitted Boilers tested under steam and spring Safety valves set to 60 lbs. per square inch.
The whole of the machinery and boilers are now in good order and safe working condition and are eligible to retain the notification Lloyd's M.C. in the Register Book.

The Amount of Fee ... 10/10 : — received by me, James Milton
Certificate (if required) ... £ : : 187
Travelling Expenses, if any, £
Committee's Minute 18

James Milton
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Machinery & Boilers repaired & submitted to Lloyd's Register have the machinery certified as eligible to retain the notification Lloyd's M.C. in the Register Book.