

Damage Repairs. 21304 37275
REPORT of SURVEY for REPAIRS, &c.
Read 13.8.78

No.

No. in
Reg. Book.

Survey held at

London

Date, first Survey

May 20

Last Survey

June 8th 1878

Master

J. Brown

YEAR.

MONTH.

TONNAGE under Tonnage Deck

2076

Ditto of Spar Deck, or Awning Deck

Ditto of Poop

Ditto of Raised Qr. Dk.

Ditto of Houses on Deck

Ditto of Forecastle

Gross Tonnage

2207

Crew Space, as per Rule

Register Tonnage, out on Beam

Engine Room

Reg. Tons as St'mer, out on Bm.

1440

Built at

Newcastle

When built

1872

8

Owners

Nelson Jonkin & Co

Port belonging to

London

Residence

By whom built

Mitchell

Destined Voyage

If Surveyed Afloat or in Dry Dock

In Dock

Length of Poop

ft.

Ditto, Forecastle

ft.

Ditto, Raised Quarter Deck

ft.

Years assigned.

Character in Register Book.

Classed

100A 10.77

Last Survey, No.

19738

Port

London

S.I. No. 77

REPAIRS, OR EXAMINATION AS PER RULE

at present owing to damage.
Additional, 5 Pairs of deep Web Frames fitted on the
Main Frames in the Engine and Boiler Rooms from
the lower hold beam stringer plate to the bilges, also
a Web Plate fitted on the top of the lower hold beam
in the Engine Room extending up to the Middle Deck
Beams.

Then double, rivetted, butt straps on the outside stroke of Plating
above bilges in Midships taken off and replaced with
wider and thicker straps treble rivetted on both sides.
Two other butt straps replaced with thicker plates on both sides
and rivetted. The Rudder pins broken, and repaired in the
Plating rivetting. R.T.O.

Cement thickened & mended.

Present Condition of the

Decks

Waterways

Comings

Upper Deck Beams & Fastenings

Lower Deck Beams & Fastenings

Planksheers

Sheerstrakes

Topsides

Wales

Plank (Bottom) and Counter

Engine Room Skylights

General Observations, Opinion as to Class, &c.

Treenails

Rivets

Breasthooks and Stenson

Transoms, Pointers, and Crutches

Timbers of the Frame at the openings

Ditto Ditto at other places

Keelsons

Clamps and Shelves

Ceiling

Rudder

Copper

When put on

Caulking of

Bottom, Deck, & Waterways

Coal Bunker, Openings, Lids, &c.

Scuppers

Windlass and Capstan

Pumps

Boats

Masts, Yards, &c.

Condition, how ascertained

Sails

Anchors No. of 3 Bn. 8 1/2 fms. 11 1/2 fms.

Cables

Hawsers and Warps

Standing & Running Rigging

Cargo and Main Hatchways

Hatches

She is now in good condition
and entitled to remain as classed.

Senhouse Martindale

The Amount of Entry Fee ...

17/6/78 Special ...

Certificate (if required) ...

(Travelling Expenses, if any, £ ...)

Committee's Minute

Character assigned

received by me,

21 June 1878

Surveyor to Lloyd's Register of British and Foreign Shipping.

18th. June

1878

100A

DRW 20/7/8



© 2019

Lloyd's Register
Foundation

21304. Jan.

all the Wood beilany on both sides of the long after
double Bottom has been taken up, & the ^{upper} double Bottom
has been tested to light mark.



© 2019

Lloyd's Register
Foundation