

REPORT of SURVEY for REPAIRS, &c.

No. 1194

22438

Rev 28/1/79

No. in
Reg. Book.

Survey held at Dundee

Date, first Survey 14th Jan Last Survey 16th Jan 1899

552 on the

Iron Ship "Durham"

Master

Seymour

TONNAGE under Tonnage Deck

895

Ditto of Spar Deck, or Avning Deck

Ditto of Poop

Ditto of Raised Qr. Dk.

Ditto of Houses on Deck

Ditto of Forecastle

Gross Tonnage

998

Crew Space, as per Rule

Register Tonnage, cut on Beam

Engine Room

Reg. Tons as St^rmer, cut on Bm.

Built at Sunderland

When built

1866 - 6

Owners Messrs Temperley, Carter & Darke Port belonging to London

Residence Offices, 21 Billiter Street, London E.C.

By whom built Oswald

Destined Voyage London.

If Surveyed Afloat or in Dry Dock Afloat

Length of Poop 58 ft. Ditto, Forecastle 30 ft. Ditto, Raised Quarter Deck

ft.

Years assigned.

Character in Register Book.

Last Survey, No. 20461 Port Iron

Classed

A.1.

ss. No 2, 75.

REPAIRS, OR EXAMINATION AS PER RULE Thro Sea damage.

2.78.

This Vessel has left in ballast for London, at which port the undermentioned repairs are to be executed and the S. S. No. 3 held.

The damage was sustained through stress of weather on the 29th Oct^r last, while on a voyage from Chittagong to Dundee.

Six bulwark stags on port side to be repaired or renewed as may be required and the whole of the others to be refastened at heel on each side of ship all fore & aft; the main rail to be refastened at parts and the outside moulding renewed where carried away on port side; six strakes of deck on each side all fore & aft to be recaulked and at other parts where required; the mountings of door to boatwain's store, galley door & poop door to be made good; lid and hinge to

P. S. O.

Present Condition of the

Decks

Waterways

Comings

Upper Deck Beams & Fastenings

Lower Deck Beams & Fastenings

Planksheers

Sheerstrakes

Topsides

Wales

Plank (Bottom) and Counter

Treenails Ribs

Breasthooks and Stemson

Transoms, Pointers, and Crutches

Timbers of the Frame at the openings

Ditto Ditto at other places

Keelsons

Clamps and Shelves Stringers

Ceiling

Rudder

Copper

When put on 1866

Caulking of

Bottom, Deck, & Waterways

Windlass and Capstan

Pumps

Boats

Masts, Yards, &c.

Condition, how ascertained

Sails

Anchors No. of

Cables

Hawsers and Warps

Standing & Running Rigging

General Observations, Opinion as to Class, &c.

The Amount of Entry Fee ... £

Damage Survey & Report ... £

Certificate (if required) ... £

(Travelling Expenses, if any, £)

not yet

received by me,

Jan 27 1879

Committee's Minute

18

Character assigned

Surveyor to Lloyd's Register of British and Foreign Shipping.



© 2019

Lloyd's Register Foundation

IRON482-0459

22738 Iran

to freeing port to be renewed, the fore-castle ladder and accommodation ladder and gratings to be renewed; one 22 ft boat to be repaired; the fittings and linings to berths on port side of poop to be made good and the berths repainted; the fresh water tank to be patched and the boomkin heel plate to be renewed.

J. L. Minette



© 2019

Lloyd's Register
Foundation