

* 22934

Report of Survey for Repairs of Engines and Boilers.

No. _____
No. in Reg. Book. Survey held at London Date, first Survey 29th Jan^y Last Survey 12th Dec^r 1879
335 on the Hon S.S. "Ituna" Tons 442
Owners LLYD'S Port belonging to London Classified M.C. 10.77 Years assigned. 90 A Character in Register Book. 11.77
Diameter of Cylinders 23" & 40" Engines made at Trillickhead When made 1877
Length of Stroke 30" Pressure of Steam 40 lbs By whom made Messrs Taylor Bros
Nominal Horse Power 80

Particulars of Repairs and Examination On account of engines and boiler having been submerged. Examined sea connections, stern shaft, propeller &c. All pumps opened out & cleared, valves renewed where necessary. Cylinders opened out, new L.P. piston fitted. Condenser examined, some rows of tubes removed for purpose of cleaning generally. New quadrant blocks fitted, of phosphor-bronze. Forky pump overhauled; new valves and seats fitted.
Main boiler examined, thoroughly cleared &c, several combustion chamber stays renewed; one or two small patches fitted to backs.
The engines and boiler are now in good and efficient condition, and in my opinion the vessel is eligible, so far as her Machinery is concerned, to remain as classed, and to be noted "2.79"


(Condition of Engines, Boilers, and subsequent Repairs and Exa

(The Surveyors are requested not to write on or below the space for Committee's Minute).

The Amount of Fee ... 13/5/79 £ 4:4:0 received by me, Alfred H. Alchin
Certificate (if required) ... £ : : 13 Mar 1879
(Travelling Expenses, if any, £ _____)

Committee's Minute 14th March 1879.

Alfred H. Alchin
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

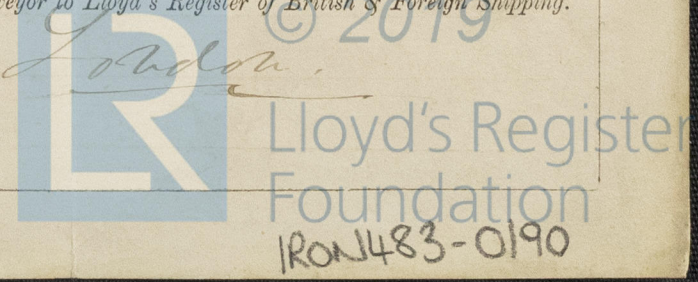

The Machinery of this vessel has been-
examined owing to the vessel being
submerged, it has been repaired
and placed in good condition
Submitted that she is eligible
to remain as licensed-
and to have a new
Certificate dated

12 Feb 1869.

MM

25-2-79



© 2019

Lloyd's Register
Foundation