

24044. from

Lloyd's Register of British and Foreign Shipping

Port of Singapore
26th April 1879.

This is to certify that I Charles Fittock the undersigned Surveyor to this Society did at the request of Captain J. Powers proceed on board the British steamer Silvpatrick now laying at New Harbour Dock Wharf found from the present Captain who brought the vessel into this Port that the ship had experienced a heavy cyclone doing the following damage carrying away the steering wheel and all the bearings for the rods. The stuffing box on the rudder head the bolts broken off. The guard rails wood and Iron and guard stanchions right fore and aft broken or bent on Port side 4 of the boats davits are broken off the remainder bent badly 3 Teak boats washed over board 2 strakes of deck plank in water of Boats davits sockets badly split and the awning deck planking started up in many places the ventilators off and on the bridge badly buckled one accommodation ladder and fittings lost one broken The doors of the cargo ports badly bent and started from the hinges.

Singapore
26th April 1879 }

Chas Fittock

On further examination I find the Engine room skylight started, doors washed away the skylight to after cabin washed away and all the cabin fittings broken or spoilt the Bollard heads and fair leaders are also started I recommend the mizen mast to be taken out the head being defective also the Foremast to be taken out it having been charged badly by the Gaff breaking loose in the Cyclone I recommend boats chocks to be fitted

94044 Iron.

for the 2 life boats to enable them to be carried inside I also find the cutter so much damaged I recommend a new one to be built the others two bowed boat to be repaired the standing rigging stranded in several places The cast iron loose flanges outside the house pipes are worn out I recommend new ones cast thicker and pub on.

Singapore
30th April 1879

Chas. Pittcock

I have again visited the vessel and find the hull inside very much corroded caused by the rice getting wet I recommend it to be sealed and painted the ceiling lifted to examine the cement some rivets require to be replaced all round the ship about 60 in No. as they are loose also the outside shell slipped from gunwale to load line badly corroded in many places on examining the fore mast I recommend a new one to be made the main mast being decayed at the head only I recommend it to be cut off as they complain of her having too heavy a rig aft as the repairs are well forward I recommend her to be docked for further examination and new her coops to be made it having been washed overboard

Singapore
9th May 1879

Chas. Pittcock

24044 Iron.

The vessel now being in dry dock I recommend the Bow plate in the 3rd strake above the keel on Starboard side be replaced with new one the edges being worn away a shoe to be fitted on the stem the plate ends being worn away with the chain cable the rudder to be lifted and fittings shrunk on and a washer placed under the lower pinhole there are several off the butts in the bilge of the vessel slightly leaking I recommend them to be caulked and the bottom painted.

Singapore
15th May 1879

Chas. Pittcock

I have again visited the vessel and find all the above recommendations completed to my satisfaction also all the deck gear repaired or renewed the ships outfit repaired or restored a new after piece of main shaft has been fitted and the propeller fixed on it having been strained in the cyclone as per Engineers certificate attached she is now in a good and efficient condition and in my opinion fit to remain as classed

Singapore
14th June 1879

Chas. Pittcock



© 2019

Lloyd's Register
Foundation