

REPORT of SURVEY for REPAIRS, &c.

(Rec'd. 16th 10/79)

No. 28572

No. in Reg. Book. Survey held at

London

Date, first Survey 5th July 79 Last Survey 15th Oct 1879

43 on the B^c Palestine

Master Maynard

TONNAGE under Tonnage Deck 552

Ditto of Spar Deck, or Awning Deck

Ditto of Poop

Ditto of Raised Qr. Dk.

Ditto of Houses on Deck

Ditto of Forecastle

Gross Tonnage

Crew Space, as per Rule

Register Tonnage, cut on Beam

Engine Room

Reg. Tons as St^rmer, cut on Bm.

Built at Belfast

When built 1863 10

Owners J. H. Hindall & Co

Port belonging to Scarborough

Residence

By whom built Harland

Destined Voyage Hong Kong

If Surveyed Afloat or in Dry Dock Carters Dry Dock

Length of Poop

ft. Ditto, Forecastle

ft. Ditto, Raised Quarter Deck

Classed

Years assigned.

Character in Register Book.

Last Survey, No. 23508

Port Iran

S. S. Lon. No 3.76

4.79

REPAIRS, OR EXAMINATION AS PER RULE on account of damage.

Vessel placed in dry dock - and her bottom scraped and painted - All the bulwark plating renewed from one plate abaft stem to the poop, on both sides - Eleven bulwark frames renewed on the Port side - being run through the stringer plate and scarfed on the frames at varying depths below - 2 plates renewed on the port side in the 1st strake below sheerstrake, abreast fore ruffing, also a plate renewed in that strake and the strake below - fared and replaced - The greater part of the main and pin rails renewed on both sides - Gutter waterways newly cemented - All the ceiling in the flat of hold from bidge keelson to bidge keelson renewed - cement examined and found good -

All topsail yards renewed, also fore and main topsails, and main topfallant yard.

Chain cables ranged on decks

Present Condition of the

Decks

Waterways

Comings

Upper Deck Beams & Fastenings

Lower Deck Beams & Fastenings

Planksheers

Sheerstrakes

Topsides

Wales

Plating (Bottom) and Counter

Engine Room Skylights

General Observations, Opinion as to Class, &c.

Good

Treenails Rivets

Good

Breasthooks and Stemson

Transoms, Pointers, and Crutches

Timbers of the Frame at the openings

Ditto Ditto at other places

Keelsons

Clamps and Shelves

Ceiling

Rudder

Copper Cement When put on

Caulking of

Bottom, Deck, & Waterways

Good

Coal Bunker, Openings, Lids, &c.

Scuppers

Windlass and Capstan

Pumps

Boats

Masts, Yards, &c.

Condition, how ascertained

Sails

Anchors No. of 3B 1S 2K

Cables 270 fathoms

Hawsers and Warps

Standing & Running Rigging

Cargo and Main Hatchways

Hatches

Good

Dr

Dr

Dr

Dr

Examined

Good

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

Dr

The Amount of Entry Fee ... £ 2 : : received by me, C. H. H.

20/10/79 Special ... £ 2 : 2 : 22 Oct 1879

Certificate (if required) ... £ : 5 : :

(Travelling Expenses, if any, £)

Committee's Minute

Character assigned

21st October, 1879.

Surveyor to Lloyd's Register of British and Foreign Shipping.

J. H. Hearn

J. H. Hearn



© 2019

Lloyd's Register Foundation

IRON 488-0163