

Report of Survey for Repairs of Engines and Boilers.

No. *25330*
 No. in Reg. Book. *1218* Survey held at *London* Date, first Survey. *Dec 5th* Last Survey *Dec 13* 18 *79*
 on the *S.S. Monaco* Master
 Built at *S. Shields* When built *1875*
 Tons *405* Owners *Causes & Robinson* Port belonging to *Liverpool* Classed *100A1*

Diameter of Cylinder *23 1/2* *± 45* Engines made at *Shields* When made *1875*
 Length of Stroke *30*
 Pressure of Steam *65* By whom made *R. I. Marshall*
 Registered Horse Power *85*

Particulars of Repairs and Examination for *S.S. No. 1*. Vessel placed on *Gridiron*, all sea cocks examined, and new propeller fitted. Cylinders pistons and slide examined, new slide fitted to Low pressure piston cylinder. Crank shaft examined and found sound. Air pump examined and found good. Donkey Boiler examined and found good. ~~new~~ safety valve recommended to be fitted in addition to present one. This, it has been arranged shall be done and notice sent to this office on the vessels arrival in port. Main Boiler examined, an additional stay fitted to Steam Dome, Boiler scaled & cleaned and cemented at bottom inside with elastic cement. Safety valves examined and found weighted correctly. The Bottom of Boiler is somewhat corroded outside but not sufficient to be dangerous at present. It is recommended that it be again examined in about six months time to see if the corrosion is increasing. Subject to the Boiler being resubmitted for survey for this purpose, and the additional safety valve being fitted to Donkey Boiler, I am of opinion that the vessel is eligible to retain her class and to have a new machinery certificate granted.

The Amount of Fee ... *24/11/79* £ *8* : *3* : *0* received by me,
 Certificate (if required) ... £ : : *24 Dec 1879*
 (Travelling Expenses, if any, £)

James S. Milner
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute Friday, August 6th, 1880

Lloyd's Register
 Foundation

IRON 489-0410

The Boiler of this vessel has
been surveyed and is reported
to be in good condition, it
is submitted that she is
devoid to return the
notification Lloyd's M.C.
12.79 and to have
B.S. 7.80 recorded,
the limitation of
certificate being
withdrawn

M.
3/8/80



© 2019

Lloyd's Register
Foundation