

Report of Survey for Repairs of Engines and Boilers.

No. 25603 (Received at London Office, 9.2.80)

No. in Reg. Book. 290 Survey held at London Date, first Survey Jan 28th Last Survey Feb. 4th 1880

on the Machinery of the S. S. "Thornbrough" (Number of Visits 4)

Tonnage, Gross 739 Built at Newcastle When built 1876

Ditto, Net 463 Owners J. Funnell & Son Port belonging to London

Diameter of Cylinder 24" and 45" Engines made by Palmer & Co. When made 1876

Length of Stroke 30" Boilers made by Palmer & Co. When made 1876

Pressure of Steam 75 lbs. If Surveyed Afloat or in Dry Dock On Pontoon

Registered Horse Power 80 Years assigned. 90 A1 Character in Register Book. Lloyds M.C. 8.76

Last Survey No. Port

Particulars of Repairs and Examination This ship grounded on the bar at the mouth of the Tees on the 14th January 1880, the boiler lifting from the seating when the ship was striking the ground. Main steam pipe indented by boiler casing. Steam gauge cock renewed. Water gauge pipes repaired, & frame of the same rejoined to boiler. Hydrokinetic pipe rejoined. Damper in funnel made to work freely. Main blow off pipe rejoined. Blocks under Boiler lined up. Starboard Suction pipe to Forward Ballast Tank to re-joint. Boiler casing repaired, and upper gratings in stoke hold & Engine Room adjusted. Planks in Engine Room floor renewed where damaged. Grank shaft lined up true to tunnel shaft. Three Muntz metal bolts renewed in suction valve of circulating pump. Steam cock on Superheater renewed and pipes from same to Donkey and Deck repaired. Condenser cleaned. Circulating pump examined. Angle irons fitted in Superheater and bottom lined with plates. The above repairs have been done to my satisfaction

General Observations, Opinion, and Recommendation:— In my opinion this ship is eligible to have a new machinery certificate granted and Lloyds M.C. 2.80 recorded in the Register Book

Special Damage 3.3

Entry or Registering Fee ... £ 1 : 0 : 0

Survey Fee ... £ 1 : 1 : 0 } received by me, E. W. Pinson

Certificate (if required) ... £ : : 19 Feb 1880

Other Expenses, if any, £

E. W. Pinson
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute

18

Assigned



Lloyd's Register
Foundation

IRON 490-0154

It is submitted that this
vessel is eligible to have
the notification Lloyd's
MC 2.80 recorded
in the Register
Book

M.
9/2/80



© 2019

Lloyd's Register
Foundation