

# Report of Survey for Repairs of Engines and Boilers.

(Received at London Office, 10/5/80.)

No. 294

No. in Survey held at South Shields Date, first Survey 14<sup>th</sup> April Last Survey 19<sup>th</sup> April 1880

Reg. Book. 1484 on the Machinery of the Leam Steamer "Austin Friars" (Number of Visits two)

Tonnage, Gross <u>1314</u>	Built at <u>Liverpool</u>	When built <u>1868</u>
Ditto, Net <u>839</u>	Owners <u>E. Pembroke &amp; Co</u>	Port belonging to <u>London</u>
Diameter of Cylinder <u>27" 5"</u>	Engines made by <u>J. Richardson &amp; Sons</u>	When made <u>1877</u>
Length of Stroke <u>30"</u>	Boilers made by <u>Do do</u>	When made <u>1877</u>
Pressure of Steam <u>65 lb</u>	If Surveyed Afloat or in Dry Dock <u>Both</u>	Classed <u>75 A 1</u>
Registered Horse Power <u>98</u>		Years assigned <u>1-79</u>
Last Survey No. <u></u>	Port <u></u>	<u>Lloyd's C. 177</u>

Particulars of Repairs and Examination The Machinery of this vessel has been


examined for Survey No. 1.  
Engines generally examined. Satisfactorily.  
Cylinders valve faces & valves examined Satisfactory.  
Crank shaft examined. Corrosion in forward pin, not  
serious. Marked same for extension.  
Examined propeller & propeller shaft. Propeller Satisfactory.  
Propeller shaft to have new brass liner fitted to outer  
bush for inner part.  
Lee cocks & valves examined Satisfactory. except  
donkey blow off which is much wasted round spigot  
recommended part to be cut out and flush plate  
fitted & valve replaced as before.  
Main boiler examined internally & externally. Satisfactory.  
Donkey boiler examined. Wasted round bottom of furnace  
recommended 4 patches to be riveted on  
The above repairs have now been Satisfactorily  
completed —

General Observations, Opinion, and Recommendation:—The Machinery of this vessel is  
now in good order and safe working condition. and eligible  
in my opinion to remain as classed in the Society's  
Register Book —

Entry or Registering Fee ... £ — : — : —  
 Survey Fee ... £ 4 : 4 : — received by me, W.G.S.  
 Certificate (if required) ... £ — : — : — 8<sup>th</sup> May 1880

John Dockett  
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute 18  
 Assigned

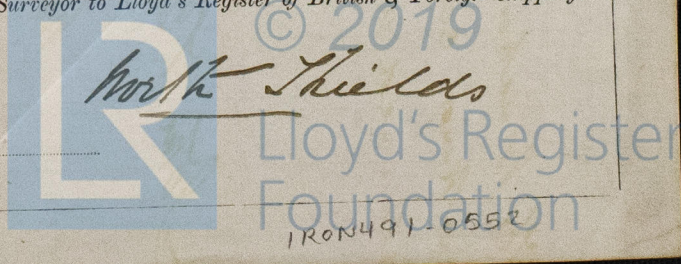



It is submitted that this  
vessel is eligible to  
have the notification

Lloyd's M.C. 4. 81

recorded in the  
Register Book

M. 10/7/81



© 2019

Lloyd's Register  
Foundation