

# REPORT of SURVEY for REPAIRS.

No. 1758 Port of London Date Sept 14 1835  
 Survey of the Ship Child Harold Master Willis  
 Tonnage 463 By whom built Sabey Bayley Where built Spurwich  
 When built 1825 Owners Geo. Willis & Co. Port belonging to London  
 Destined Voyage \_\_\_\_\_  
 Surveyed Afloat or in Dry Dock Dry Dock

Original Survey, No. 380 Dated July 1834 ~~1835~~  
 Port London Class 10 A 1

## Repairs.

Butts of the Toppers and Planksheads caulked -  
 Copper examined - in good condition

October 17<sup>th</sup> 1835. Since the date of this Report. The Toppers have been caulked  
 and two pieces of Plank shifted - In my opinion she still  
 wants repair in her Toppers - George Bayley


## General Observations and Opinion, as required by the Instructions

This ship has worked considerably in her upper works  
 The Foremast Beam is broken - and the Stern Post has worked  
 aloft - left a written notice recommending that the  
 upper works should be well looked after, together with  
 some repairs to the Beam & Stern Post. The ship  
 left the Dock & nothing effectual has been done -  
 On reference to the original survey it will be seen that  
 some indications of weakness were observed last year  
 which are very much increased at the present time -  
 From my knowledge of her original construction I believe her  
 to be defective only in the Toppers George Bayley

The Amount of Fee..... is received by me.

Committee Minute 10 December 1835

Character assigned Continues Class but insert, "Toppers slightly defective"  
M.H.

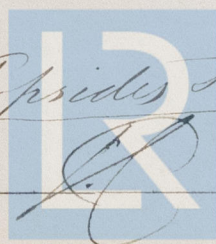

© 2019  
 Lloyd's Register  
 Foundation

LON 598-0062

8 Dec.  
 refer to General Instructions