

REPORT of SURVEY for REPAIRS.

No. 3699 Survey held at London Date Oct 10th 1837
on the Ship Roberts Master B. R. Allen
Tonnage 723 Built at Bulwer When built 1815
By whom built _____ Owners Capt. Co.
Port belonging to London Destined Voyage India
If Surveyed Afloat or in Dry Dock Blackett Dock during the Repair

Original Survey, No. 16498272 Dated 1831 Clapd A. 1
Port London

Repairs. At the present time doubled with African Oak upon Patent Felt from ^{mid} ~~Deck~~ Strake below the Wale to the Plank sheer. The heavy girdwork removed. New transverse Plank sheers Spirketting Slupper Deck Watertight wing. First, second and half the third Transom shifted Port and Inner Port and Chain Port - part and Counter aloft after cut of the doubling & Plank of the chain Bottom renewed. - The Upper and lower Deck knee framing partly through the doubling (Port & hold) - new haulls throughout Caulked from the Keel on all & sheathed with yellow metal to the wale

The Surveyor to state the present Condition of

Upper Deck Fastenings Part renewed

Spirketting all new

Plank Sheers do

Topsides Doubled 1837

Upper Deck with its Appendages Good

Lower Deck Fastenings Part renewed

Master & Quarters 3 Shutsails 2 of 4

Wales Doubled 1837

Counter Part new

Plank and Treenails Good

(Outside to the Water's Edge)

Rudder Refitted

Windlass _____

Copson Overhauled

General Observations and Opinion. The timbers of this ship afloat were found in as required by the Instructions, good condition. The whole of the defective parts afloat are believed to have been renewed and this is now in my opinion sufficient for the safe consequence of dry, fresh & cargo to form all parts of the vessel should be

The Amount of Fee..... £ 3 : 3 : is received by me, Clapd A. 1

Committee Minute 16 Feb 1837

Character assigned As a