

# ANNUAL SURVEYS.

4819

No. 4810 Survey held at London Date Jan 11 1839  
 on the Schooner Monarch Master Manning  
 Tonnage 121 Built at Ipswich When built 1838 July  
 By whom built Wm Bayley Owners Wm Butter & Co Shesham 141  
 Port belonging to London Destined Voyage Hartford Shoreditch  
 If Surveyed Afloat or in Dry Dock Crispstray

Original Survey, No. 154 Port of Ipswich July 1838 Classed 1241  
 and 4649 " London

The Surveyor is required to state the present Condition of the

Decks <u>Good</u>	Breasthooks <u>Good</u>	Capstan
Upper Deck Beams & Fastenings <u>Iron</u>	Transoms <u>"</u>	Pumps
Lower Deck Beams & Fastenings <u>"</u>	Timbers of the Frame <u>"</u>	Masts, Yards, &c.
Spirketting <u>Good</u>	Topsides <u>"</u>	Sails
Plank Shears <u>"</u>	Wales <u>"</u>	Cables
Waterways <u>"</u>	Plank and Treenails <u>Several Keelson's started in last voyage</u>	Anchors No. of
Hatchway Comings <u>"</u>	Rudder <u>Hanging started to rot</u>	Standing & Running Rigging
	Windlass <u>Good</u>	Copper

General Observations and Opinion, as required by the Instructions,  
Working on the Causeway at Shesham last voyage. The Keelson sprung in the scuff - Fastenings in lower Brace started and the Keel of Sternport split, about 20 Keenails started in last voyage. Recommended to put in a sliding Keelson, additionally Bolt the Sternport, put in 2 pair dovetail plates and secure the Hanging after Rudder. It is stated that they cannot detain the vessel to do the above now, but on her return 10 days hence will have the damages repaired.

Committee Minute 15 Jan 1839

Character assigned Wants repairs  
Wm Bayley examine character repaired Wm Bayley

No. \_\_\_\_\_ Survey held at \_\_\_\_\_ Date \_\_\_\_\_ 18\_\_\_\_  
 on the \_\_\_\_\_ Master \_\_\_\_\_  
 Tonnage \_\_\_\_\_ Built at \_\_\_\_\_ When built \_\_\_\_\_  
 By whom built \_\_\_\_\_ Owners \_\_\_\_\_  
 Port belonging to \_\_\_\_\_ Destined Voyage \_\_\_\_\_  
 If Surveyed Afloat or in Dry Dock \_\_\_\_\_

Original Survey, No. \_\_\_\_\_ Port of \_\_\_\_\_ Classed \_\_\_\_\_

The Surveyor is required to state the present Condition of the

Decks	Breasthooks	Capstan
Upper Deck Beams & Fastenings	Transoms	Pumps
Lower Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Spirketting	Topsides	Sails
Plank Shears	Wales	Cables
Waterways	Plank & Treenails	Anchors No. of
Hatchway Comings	(Outside to the Water's Edge)	Standing & Running Rigging
	Rudder	Copper
	Windlass	

General Observations and Opinion, as required by the Instructions,

Committee Minute \_\_\_\_\_ 183

Character assigned \_\_\_\_\_

