

# REPORT of SURVEY for REPAIRS.

Oct 23<sup>rd</sup> 1836

No. 4996 Survey held at London Date January 28 1837  
 on the Blackfriars Master Row  
 Tonnage 488 Built at Hull When built 1816  
 By whom built \_\_\_\_\_ Owners Smith & Mann  
 Port belonging to London Destined Voyage Sydney  
 If Surveyed Afloat or in Dry Dock Pitcher Dock during repair

Original Survey, No. Annexed Dated \_\_\_\_\_ Classed \_\_\_\_\_  
 Port London

**Repairs** This vessel is described to have had part of her upperworks in 1829  
 Some repairs in 1831-1833 & some in successive years  
 as described in annexed survey.

At the present time in consequence of having been ashore  
 and severely strained particularly about the lower deck & bottom  
 has shipped & examined certain repairs recommended, comprising  
 amongst others, the refastening of the lower deck beams & knees to  
 9 Strakes of Ceiling in each Ridge amidships. 2. 1<sup>st</sup> & 3. 2<sup>nd</sup> Buttresses  
 shifted just abaft chain stanchion. 2 pair of Iron knees to the present  
 Hold beams about 12 of the upper and down bolts of the lower  
 knees to the lower deck shifted - Caulked from keel up. Plated  
 sheathed with 1" board & coppered to keel

The Surveyor is also required to state the present Condition of the

Decks <u>Upper &amp; Double</u> <u>Good</u>	Transoms <u>Good fair order at bridge</u>	Windlass _____
Upper Deck Beams & Fastenings <u>Fair</u>	Timbers of the Frame <u>in general</u>	Capstan _____
Lower Deck Beams & Fastenings <u>worked</u>	Topsides <u>Several pieces moderate</u>	Pumps _____
Spirkettling <u>Fair</u>	Wales <u>"</u>	Masts, Yards, &c. <u>Good &amp;</u>
Plank Shears <u>Indifferent</u>	Counter _____	Sails <u>efficient</u>
Waterways <u>Fair</u>	Plank and Treennails <u>Many pieces in upper course below good</u>	Cables _____
Hatchway Comings _____	Rudder <u>Good</u>	Anchors No. of _____
Breasthooks _____	Copper <u>1837</u>	Standing & Running Rigging _____

General Observations and Opinion,

On the 15 Jan<sup>y</sup> I saw this vessel frame before the ceiling was shot  
 as required by the Instructions, in & the Bottom caulked - and left a note recommending that  
 the lower deck fastenings should be shifted &c. I am of opinion  
 that she is insufficiently repaired

*George Bayley*

The Amount of Fee.....£ 2 : 2 : is received by me, *Wm. L. Vane*

Committee Minute \_\_\_\_\_ 18 \_\_\_\_\_

Character assigned \_\_\_\_\_