

REPORT of SURVEY for REPAIRS.

Re entry - 6590

No. 196 Survey held at London Date Aug. 14 1840
 on the Brig Eleanor Master Bruce
 Tonnage 322 Built at Swine When built 1800
 By whom built _____ Owners Harbottle
 Port belonging to Newcastle Destined Voyage Quebec
 Surveyed ~~At~~ in Dry Dock Messrs. Harrison

Original Survey, No. 1285, 3685, Dated _____ Classed As expired
 Port London

Repairs,

At the present time filled her with water to find leaks. Found it running from every butt & also from a number of Bolt-holes & a short piece of Doubling on the Star-board, Caulked the Butts (only) and punched up the defective bolts. Left a Card with the Owner. Recommending to ship the defective Ceiling; fit 12 long Iron Rods from the Lower deck. to take 2 bolts in the floor; thoroughly Caulk the Bottom, & ship one Plank in the caulking on the Star-board side, which has not been completed with

The Surveyor is also required to state the present Condition of the

Decks	Transoms	Windlass
Upper Deck Beams & Fastenings	Timbers of the Frame	Capstan
Lower Deck Beams & Fastenings	Topsides	Pumps
Spirkettling	Wales	Masts, Yards, &c.
Plank Shears	Counter	Sails
Waterways	Plank & Treenails (Outside to the Water's Edge)	Cables
Hatchway Comings	Rudder	Anchors No. of
Breasthooks	Copper	Standing & Running Rigging

General Observations and Opinion,
 as required by the Instructions,

This vessel appears weak and strained all fore & aft. The Ceiling is very bad - and from the general appearance of the Ship I am of opinion she is not fit to go to sea in her present state

The Amount of Fee.....£ : : is received by me,

Committee's Minute, 13 August 1840

Character assigned weak & unfit for service