

REPORT of SURVEY for REPAIRS.

1393

No. 159 Survey held at London Date 22nd Dec 1847
 on the B^{re} "Milford" Master Math^r Davis
 Tonnage 262 Built at Bideford When built 1838
 By whom built Forde Owners Forde
 Port belonging to London Destined Voyage Bombay
 If Surveyed Afloat or in Dry Dock in Hawks Dock

Last Survey, No. 971

Classed 12A1

Port Bristol

REPAIRS

at present from damage bottom ^{hull} stripped and sheathed with yellow metal on ^{hull} super - and not from damage three lengths of wale planks renewed on the starboard side (of Moroa) and all the timbers of the frame ^{upper} perfectly sound - all the treenails renewed from the sheerstrakes to the bilges (about 7000 in number) - the quarter deck has been shortened 12 feet and two new upper deck beams put in after hatch 1 pair of iron knee riders fitted in after hold 1 pair of drag iron knees at breast of quarter deck and 2 stable standards at main rigging also new iron crutch in after body - new after hatch Comings and all after lengths of upper deck new from main hold

Present Condition of the

Decks new from quarter deck to main hatch all good
 Waterways good
 Comings new after hatch
 Upper Deck Beams & Fastenings good
 Lower Deck Beams & Fastenings good
 Planksheers good
 Sheerstrakes retrieved
 Topsides and
 Wales caulked
 Plank (Bottom) and Counter good

Treenails 7000 new
 Breasthooks and Stenson good
 Transoms, Pointers, and Crutches new of iron
 Timbers of the Frame good
 Keelsons good
 Clamps and Shells good
 Ceiling good
 Rudder basin retasted
 Copper on super new
Dec 1847

Windlass and Capstan good
 Pumps all
 Boats three
 Masts, Yards, &c. new main fore mast
 Sails 2nd sheet
 Anchors No. of 3
 Cables sufficient
 Hawseers and Warps one set
 Standing & Running Rigging sufficient

General Observations and Opinion

This vessel is now in very efficient condition and may remain as clashed

The Amount of Fee £ 2 is received by me, J. H. H. H.

Certificate (if required)

Committee's Minute 7th Jan 1848

Character assigned 12 D 6

Special Damage £4.4



© 2019

Lloyd's Register Foundation

LOA 624-0122

13939 Lon

Ceiling and Clamps generally refastened. Rudder
bands off and refastened - New Main & Hely. Pumps
fitted - Hull, Spars, & Rigging generally overhauled
and refitted -

J. H. Ritchie



© 2019

Lloyd's Register
Foundation