

15100

REPORT of SURVEY for REPAIRS.

No. 175 Survey held at London Date 6 Jan 1849
 on the Mr Castle Cuckoo Master
 Tonnage 435 Built at Greenock When built 1841
 By whom built _____ Owners Darwin
 Port belonging to London Destined Voyage Jamaica
 If Surveyed Afloat or in Dry Dock London at the Custom

Last Survey, No. 14000 Port London Classed F
 REPAIRS Nov 1848 Not Surveyed under the Rules Dec 54-60

On the Starboard side 56 new top timbers 7 filling do of ruff pine planks of English Oak
 On the Starboard side 52 new top timbers, 6 filling do of ruff pine do of English Oak
 New water ways from poop forward, new plank sheers upper deck shelf, clamps and post new twist deck ledges quarter post, new sheer strakes, part new Black Stakes in both sides of first rate material, 7 new upper deck Beams and 3 half Beams, 14 new lodging knees

Decks	Treenails <u>new from London</u>	Windlass and Capstan <u>new</u>
Waterways <u>new solid Danish pine</u>	Breasthooks and Stemson <u>good</u>	Pumps <u>no</u>
Comings <u>good</u>	Transoms, Pointers, and Crutches <u>good</u>	Boats <u>no</u>
Upper Deck Beams & Fastenings <u>new from</u>	Timbers of the Frame <u>new top timbers</u>	Masts, Yards, &c. <u>no</u>
Lower Deck Beams & Fastenings <u>good</u>	Keelsons <u>good</u>	Sails <u>no</u>
Plank sheers <u>new 2 I beams</u>	Clamps and Shelves <u>upper deck, Danish pine</u>	Anchor No. of <u>2 B 15 lb</u>
Sheerstrakes <u>new 2 I beams</u>	Ceiling <u>good</u>	Cables <u>no</u>
Topsides <u>plank</u>	Rudder	Hawsers and Warps <u>no</u>
Wales	Copper	Standing & Running Rigging <u>no</u>
Plank (Bottom) and Counter	When put on	

General Observations and Opinion, She has now received a very valuable repair as described above, and is in the most efficient condition for the conveyance of dry and perishable cargo to & from all parts of the world and may

The Amount of Fee £ 2 : - : - is received by me,
 Special..... 3 : 3 : - 17/14/49 Remaind Clapped

Certificate (if required)

Committee's Minute 20th April 1849

Character assigned First Class
 Special £ 3 0



8620929N07

Repairs Continued 15100. Jan

All new bolts in Hoop Bands and, the new new Chain bolts
and new work of rigging overhead -
The new lower deck Beam and half the bolts knees
all new fastenings to lower deck knees, and 5 pairs
of Iron hanging knees added, the upper course of the
bottom shipped and the planks refastened ~~and~~ caulked
and ~~reshed~~, ^{upon feet and of metal as high as formerly} new sheke of the deck over the water
way other parts unaltered. Caulked up over all sculler
the decks, new pillars to Beams and ceiling generally
repaired and refastened

For your
W. R. R. R.



© 2019

Lloyd's Register
Foundation