

15855

REPORT of SURVEY for REPAIRS.

No. 123 Survey held at London Date 6th 11 March 1850
 on the Brig Sandwich Master D. Peddie
 Tonnage 150 Built at Falmouth When built 1810
 By whom built _____ Owners Morton & Co
 Port belonging to London Destined Voyage Port Natal
 If Surveyed Afloat or in Dry Dock in Globe Dock

Last Survey, No. 359 Port Penang Classified A. 1

REPAIRS

The owner of this Vessel ordered a Survey to be held on her to point out the necessary repairs to have her Claps altered when he found the fore hoods of the hold Culmy removed which exposed 3 defective timbers on the Starboard bow and two short timbers that had been unstopper by Cut off when last repaired and 2 defective timbers on the Larboard bow. The Culmy was found defective under the two lower breastwork. We recommended the lower hoods to be taken down the defective timbers shifted the wood sheathing on the bows to be stripped off and the fastenings between the outside & Culmy planks but the owner declined doing so & thus

Present Condition of the

Decks	<u>Good</u>	Treenails	<u>Not seen</u>	Windlass and Capstan	<u>Good</u>
Waterways	<u>Good</u>	Breasthooks and Stemson		Pumps	
Comings	<u>---</u>	Transoms, Pointers, and Crutches	<u>generally sound when</u>	Boats	
Upper Deck Beams & Fastenings	<u>---</u>	Timbers of the Frame	<u>seen</u>	Masts, Yards, &c.	<u>Sufficient</u>
Lower Deck Beams & Fastenings		Keelsons		Sails	
Planksheers	<u>Good</u>	Clamps and Shells	<u>Good</u>	Anchors No. of	<u>Sufficient</u>
Sheerstrakes	<u>---</u>	Ceiling	<u>Not there fastened</u>	Cables	<u>5</u>
Topsides	<u>---</u>	Rudder	<u>on</u>	Hawsers and Warps	<u>2</u>
Wales	<u>---</u>	Copper	<u>gone</u> When put on <u>Mar</u>	Standing & Running Rigging	<u>2</u>
Plank (Bottom) and Counter	<u>not seen</u>		<u>1830</u>		

General Observations and Opinion.

I am the owner of opinion that under the above circumstances she should not return her present high Clap but being fit for the safe

The Amount of Fee.....£ : : is received by me, Conveyance of Cargoes
 Special..... : : not in their nature subject
 Certificate (if required) : : to sea damage the
 may be Clapsed & I
 Committee's Minute 15th March 1850
 Character assigned Reduce to F. 1
Special L. 1

15855 Lon

only Replaced the Ceiling Spikes to the timbers with about
six three bolts on each side without removing the wood
sheathing — and has sheathed the bottom with zinc
None of the Regicides of Rebe Sect: 54 & Co. Compl.
with —

J. H. Ketcher



© 2019

Lloyd's Register
Foundation