

# REPORT of SURVEY for REPAIRS.

*Continuation*

No. *510* Survey held at *Sondou* Date *3<sup>rd</sup> to 13<sup>th</sup> Mar. 1857*  
 on the *Sch. "Pasha"* Master *J. Leggett*  
 Tonnage *185* Built at *Yarmouth* When built *1830*  
 By whom built \_\_\_\_\_ Owners *Siddle & Siddle*  
 Port belonging to *Sondou* Destined Voyage \_\_\_\_\_  
 If Surveyed Afloat or in Dry Dock *in Williams Dock*

Last Survey, No. *921*

Port *Lpool*

Classed *12* *11*

REPAIRS

at Present Wales topsides and Sheerstrakes, Plank sheers and waterways Scraped bright and bolts and treenails driven out for Survey. The treenails were found sound & good but the bolts were rotten and have been renewed in the iron hanging knees of both decks - two lengths of waterways renewed amidships on both sides and the Plank sheers on the Starboard side renewed from the fore Channels aft strake of deck new next the waterways 3 new wood lodging knees fitted to upper deck beams 4 new roughen stanchions and Port new bulwarks on the Starboard side - the timber strakes thro' bottom

Present Condition of the

Decks *Fairly new*

Waterways *Part new*

Comings

Upper Deck Beams & Fastenings

Lower Deck Beams & Fastenings

Plank sheers

Sheerstrakes

Topsides

Wales

Plank (Bottom) and Counter

Treenails

Breasthooks and Stemson

Transoms, Pointers, and Crutches

Timbers of the Frame

Keelsons

Clamps and Shelves

Ceiling

Rudder

Copper *4m* When put on *1848*

Windlass and Capstan

Pumps

Boats

Masts, Yards, &c.

Sails

Anchors No. of

Cables

Hawsers and Warps

Standing & Running Rigging

*Good*

*Good*

*Good*

*Sufficient*

General Observations and Opinion,

*This vessel is now in efficient Condition and eligible to be Continued on the first Class for the longest period prescribed by the Rules*

The Amount of Fee.....£ *2* : - : - is received by me, *Leg. for 1857. 4/11/57*

Special..... *3* : *3* : -

Certificate (if required) : *5* : -

Committee's Minute

Character assigned

*19<sup>th</sup> March 1857*  
*Class A*

*J. H. Ritchie*  
*J. D. Courtney*

*1857*  
*Lloyd's Register Foundation*

LON631-0352



17394 Lon

with yellow metal. Several new (say 6) short  
top timbers & filling timbers fitted where the floor  
was removed. — Keel seams & hooding ends of  
and yellow metal sheathing of keel & bottom  
repaired. — The outside & ceiling planks and the  
fastenings, joining thro the same the floor & the  
waterways and beams the house timbers the  
heads breasthooks & transoms the floors & the  
where seen are found good & the sheer and  
general form appear unaltered. — all  
the requisites of rule Sect. 54 have been complied  
with. —

J. H. Richey



© 2019

Lloyd's Register  
Foundation