

18852

REPORT of SURVEY for REPAIRS.

of damage

No. 57 Survey held at London Date 8th to 15th March 1854
on the Bark "Rangoon" Master Gribble
Tonnage 384/413 Built at Sunderland When built 1853
By whom built Owners Buchanan
Port belonging to Sunderland Destined Voyage
If Surveyed Afloat or in Dry Dock Tindall's dry dock

Last Survey, No. 1908 Port Sunderland Classed S A 1

REPAIRS Now done. Yellow metal strapped off, ship hung in shores, and caulked from keel up, and the Yellow metal renewed on the bare plank. Two planks of the deck on the Starboard side and seven on the Port side renewed, having been broken. One hold beam knee on the port quarter renewed, being broken. 15 Hold beam bolts which were started, renewed.

Present Condition of the

Decks	Good	Treenails		Windlass and Capstan	
Waterways	"	Breasthooks and Stemson		Pumps	
Comings	"	Transoms, Pointers, and Crutches		Boats	
Upper Deck Beams & Fastenings		Timbers of the Frame	Good where	Masts, Yards, &c.	Good and
Lower Deck Beams & Fastenings	Good	Keelsons	seen	Sails	sufficient
Planksheers	where	Clamps and Shelves		Anchors No. of	
Sheerstrakes	seen	Ceiling		Cables	
Topsides		Rudder		Hawsers and Warps	
Wales		Copper & Metal	When put on Now new	Standing & Running Rigging	
Plank (Bottom) and Counter					

General Observations and Opinion, This vessel had been on shore, which rendered the above repairs necessary. She is now in a good and efficient state of repair, and fit, in our opinion to remain as classed.


The Amount of Fee £ is received by me, Richard Abetbell, M.M. Fortye

Special.....

Certificate (if required) :

Committee's Minute 17th March 1854

Character assigned S A 1 Under L.P.

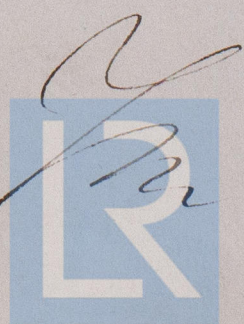

© 2019 Lloyd's Register Foundation

Lon 634-0271