

# REPORT of SURVEY for REPAIRS.

18932

No. 386 Survey held at London Date 31 March 1854  
 on the Sch Princess Alice Master Wilkinson  
 Tonnage 142 Built at Christchurch When built 1843  
 By whom built 120 Owners Wilkinson X  
 Port belonging to Demarara Destined Voyage                       
 If Surveyed Afloat or in Dry Dock Regent Dock Wray

Last Survey, No. 10800 Port Liverpool Classed Class omitted

## REPAIRS

Survey for Asterisk - On the requisitions of Rule Section 60 being  
 Complied with Found the Starboard Knighthead & House timber  
 defective Sheer Strake & part-plank sheer on same side defective  
 of the treenails in Topsides & Sheerstrake very loose - Fore Main  
 Hatch Beam broken & also one Bridgship Hold Beam On the  
 Deck plank next Waterway being taken out several of the Beam  
 ends & knees were defective  
 The Owner on witnessing the above declines proceeding any further  
 with the Survey for Classing

### Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Keelsons	Sails
Plank sheers	Clamps and Shelves	Anchors No. of
Sheerstrakes	Ceiling	Cables
Topsides	Rudder	Hawsers and Warps
Wales	Copper When put on	Standing & Running Rigging
Plank (Bottom) and Counter		

### General Observations and Opinion,

Under her present condition We are of opinion  
 that this vessel is not eligible to be classed

Thomas Alexander  
 W M Intyre

The Amount of Fee.....£ : : is received by me,

Special..... / : / : 0 -

Certificate (if required) : :

Committee's Minute 21<sup>st</sup> April 1854

Character assigned Sound Survey  
LR

LON634-0349