

REPORT of SURVEY for REPAIRS.

No. 434 Survey held at Lt Garmouth Date Feb¹⁶th to July 28th 1859
 on the S^r "William" Master
 Tonnage 122 Built at Leighmouth When built 1828
 By whom built Owners Ambrose Palmer
 Port belonging to Garmouth Destined Voyage Coasting
 If Surveyed Afloat or in Dry Dock On the slip Palmers building yard

Last Survey, No. 434 Port Garmouth Classed 11 E. 1 Ship omitted

REPAIRS

Now done. lengthened sixteen feet in midships and the new timbers of the frame all of English Oak, waterways and decks all renewed, one after hood on port buttock new of English Oak main keelson new of English Oak also two deck beams & midship shifts of outside planking from plank sheers to lower part of wales and from thence down to keel of Pitch Pine and American Elm - midship plank inside of new and second hand English Oak and Pitch Pine. Retenailed and caulked throughout. Windlass and Winch renewed - Added eight iron vertical knees to upper deck beams also two pairs of diagonal knee riders to hold beams and two pairs of diagonal riders extending from the upper deck clamp to take two bolts in the floors &

Present Condition of the

Decks	} new	Treenails	new of Eng oak	Windlass and Capstan	Winch new
Waterways		Breasthooks and Stemson	} good where seen	Pumps	2 of Iron
Comings	} good	Transoms, Pointers, and Crutches		Boats	one good
Upper Deck Beams & Fastenings		Timbers of the Frame	Masts, Yards, &c.	} good and sufficient	
Lower Deck Beams & Fastenings	where seen	Keelsons	Sails		
Planksheers	do	Clamps and Shelves	} good where seen	Anchors No. of	
Sheerstrakes	do	Ceiling		Cables	
Topsides	do	Rudder	Hawsers and Warps		
Wales	do	Copper	When put on	Standing & Running Rigging	
Plank (Bottom) and Counter	do				

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways.

good where tried

This vessel is now in good condition fit for the conveyance of dry and perishable cargoes on shorter voyages and is eligible in my opinion to be classed

The Amount of Fee.....£ 10 : 0 : 0 is received by me,

Special..... 1 : 0 : 0

Certificate (if required) : 2 : 6

Committee's Minute 16th September 1859

Character assigned E. 1

record Engineer of repairs



© 2019

Lloyd's Register Foundation

LOV 041-0301