

REPORT of SURVEY for REPAIRS.

No. 913 Survey held at London Date 25th Jan^y 18⁶¹
 on the Ship "Monarch" Master A Day
 Tonnage 701 Built at Liverpool When built 1851
 By whom built _____ Owners Brunel
 Port belonging to Liverpool Destined Voyage To India
 If Surveyed Afloat or in Dry Dock Princes dry dock & East India Dock

Last Survey, No. 16116 Port Liverpool Classed 13A1

REPAIRS now done

The yellow metal sheathing stripped. The vessel caulked from keel to gunwale and the bottom resheathed with yellow metal on felt.

One plank in wales on the port bow renewed with teak and one on the port quarter carved in one upper deck beam end on the starboard side renewed with teak, and on the port side abreast of the foremast, three beam ends, one length of waterway one length of upper deck stamp, three planks of sheestrakes six short optimizers and two rougheners and fitting pieces of plank-sheer all renewed with teak and English oak one short plank in topoles renewed and sixteen shifts in deck four lodging knees taken down and fitted.

Present Condition of the

Decks <u>16 shifts new</u>	Treenails <u>Good where seen</u>	Windlass and Capstan <u>Good</u>
Waterways <u>one piece</u>	Breasthooks and Stenson <u>Good</u>	Pumps _____
Comings <u>Good</u>	Transoms, Pointers, and Crutches _____	Boats <u>Good</u>
Upper Deck Beams & Fastenings <u>part new</u>	Timbers of the Frame <u>part new good</u>	Masts, Yards, &c. _____
Lower Deck Beams & Fastenings <u>Good where seen</u>	Keelsons <u>Good</u>	Sails <u>Sufficient</u>
Plank-sheers _____	Clamps and Shelves <u>part new</u>	Anchors No. of _____
Sheestrakes <u>part new</u>	Ceiling <u>Good</u>	Cables <u>where</u>
Topsides <u>Good</u>	Rudder _____	Hawsers and Warps _____
Wales _____	Copper <u>on felt</u> When put on <u>now done</u>	Standing & Running Rigging <u>seen</u>
Plank (Bottom) and Counter _____		

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. Good where tried

This ship is now in good and efficient condition, eligible to remain as classed 13A1.

The Amount of Fee.....£ 2 : : is received by me,

Special..... 2 : 2 : _____

Certificate (if required) : : _____

Committee's Minute 19th March 18 61

Character assigned 13A1

second repair



© 2021

Lloyd's Register Foundation

LN644 0063

23771 Lon

REPORT of SURVEY for REPAIRS.

Home to the timber and one hanging knee renewal
Added, six pairs of iron knee riders in total
Iron Mast heads fitted to fore & main masts.

W. Humphreys
Thos. McWanna



© 2021

Lloyd's Register
Foundation