

24238

REPORT of SURVEY for REPAIRS.

No. 370 Survey held at London Date Oct 3rd 18 61
 on the S. Granite City Master W. Leake
 Tonnage 771 Built at Aberdeen When built 1853
 By whom built _____ Owners Adamson
 Port belonging to Aberdeen Destined Voyage Sydney
 If Surveyed Afloat or in Dry Dock Simultaneously dry dock & E. J. Dock

Last Survey, No. 21817 Port London Classed 10 A 1

REPAIRS

In consequence of decay; on Starboard side six toptimbers and two Roughtrees renewed with Teak & Eng. Oak, two midship lengths of shelf and one of clamp of P. Pine and American Oak - and ten planks of topside of P. Pine - on port side, four roughtrees of Teak; two lengths of shelf and one of clamp of P. Pine and American Oak one half beam and one beam arm of Greenheart, the yellow metal repaired and the ship recaulked from the metal line up -

Present Condition of the

Decks		Treenails		Windlass and Capstan	
Waterways	} Good	Breasthooks and Stemson	} Good	Pumps	
Comings		Transoms, Pointers, and Crutches		Boats	
Upper Deck Beams & Fastenings	} do	Timbers of the Frame	} where seen	Masts, Yards, &c.	} In good order and sufficient
Lower Deck Beams & Fastenings		Keelsons		Sails	
Planksheers	} where seen	Clamps and Shelves	} do	Anchors No. of	
Sheerstrakes		Ceiling		Cables	
Topsides	} do	Rudder	} do	Hawsers and Warps	
Wales		Copper <u>T.M. & P.H.</u> When put on <u>1858</u>		Standing & Running Rigging	
Plank (Bottom) and Counter	} do				

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. good where tested

This vessel is now in good and efficient condition and is eligible in my opinion to remain classed 10 A 1

The Amount of Fee.....£ 2 is received by me,

Special..... 2 : 2 :

Certificate (if required) : 5 :

Committee's Minute 22nd October 18 61

Character assigned 10 A 1 record report



© 2021

Lloyd's Register
Foundation

LON644 - 0482