

24794

REPORT of SURVEY for REPAIRS.

No. 161 Survey held at London Date 19th June 18 62
on the S. Derwentwater Master Thomson
Tonnage 62 3 Built at Sunderland When built 1852
By whom built _____ Owners Richardson
Port belonging to London Destined Voyage Canterbury, New Zealand
If Surveyed Afloat or in Dry Dock Lincoln dry dock

Last Survey, No. 23956 Port London Classed 12 A 1
5. 6.

REPAIRS

Yellow metal sheathing stripped off. Recaulked from keel to metal line, caulking tested and five seams on each side at bilges found defective, recaulked; retested and found good; resheathed with yellow metal on three courses of felt above and on paper below.

The strake of deck next waterways on each side also three planks on starboard and four on port side renewed with yellow pine —

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stenson } <u>Good</u>	Pumps
Comings	Transoms, Pointers, and Crutches } <u>where</u>	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame } <u>seen</u>	Masts, Yards, &c. } <u>In good order</u>
Lower Deck Beams & Fastenings	Keelsons } <u>not seen</u>	Sails } <u>order</u>
Planksheers	Clamps and Shelves } <u>Good where</u>	Anchors } <u>No of</u>
Sheerstrakes	Ceiling } <u>seen</u>	Cables } <u>sufficient</u>
Topsides	Rudder } <u>seen</u>	Hawsers and Warps
Wales	Copper } <u>on pt</u> When put on <u>new</u>	Standing & Running Rigging
Plank (Bottom) and Counter		

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. good where tested

This vessel appears in good condition and is eligible in my opinion to remain classed 12 A 1

The Amount of Fee.....£ : : is received by me, Thos. W. Hawn

Special..... 2 : 2 : } RS.

Certificate (if required) : 5 :

Committee's Minute 29th July 18 62

Character assigned 12 A 1

record GM



© 2019

Lloyd's Register Foundation

LON645-0507