

REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 485 Survey held at London Date Sept 14th to 29th 1864
 on the Ship "Munnymede" Master _____
 Tonnage 720 Built at Sunderland When built 1854
 By whom built _____ Owners The Lewis
 Port belonging to London Destined Voyage _____
 If Surveyed Afloat or in Dry Dock Lincolnton Dry Dock & London Dock

Last Survey, No. 24595 Port London Classed 11A.1
 3.62

REPAIRS

On examination, found five upper deck beamends on the port side and one on the starboard side, and the scarphs of two pieces of waterway defective and her sheer very much deformed.

We therefore respectfully recommended, that the defective beam ends be renewed, the scarphs of the waterway cut into for further examination, and that treenails be driven out from several parts, for the examination of the timbers and planks through which they pass - before we could report her to the Committee to retain her present class.

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stemson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame at the openings	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Ditto Ditto at other places	Sails
Planksheers	Keelsons	Anchors No. of
Sheerstrakes	Clamps and Shelves	Cables
Topsides	Ceiling	Hawsers and Warps
Wales	Rudder	Standing & Running Rigging
Plank (Bottom) and Counter	Copper <u>Y. Maple</u> When put on <u>1862</u>	

General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways.

Our recommendations have not been attended to - we therefore respectfully beg to suggest that her class be suspended until the necessary repairs be effected.

The Amount of Fee.....£ : : is received by me,

Special..... : :

Certificate (if required) : :

Committee's Minute 14th October 1864

Character assigned expunge Character

No tie to Owners
 Letter 14.10/64.

Wormish
Robt. Frachar



© 2019

Lloyd's Register
 Foundation
 LON 649-0016