

# REPORT of SURVEY for REPAIRS.

28990

No. in Reg. Book. **No.** 131 Survey held at London Date Jan<sup>y</sup> 22<sup>d</sup> to 27<sup>th</sup> 1868  
 on the Ship "Ontario" Master Watson  
 Tonnage 1062 built at Quebec When built 1861  
 By whom built \_\_\_\_\_ Owners Stuckey &c.  
 Port belonging to Bridgewater. Destined Voyage not fixed  
 If Surveyed Afloat or in Dry Dock Imekilu Dry Dock

Last Survey, No. 27303 Port London. Classed 7 A. 1.  
 2. 66

## REPAIRS

now done, The metal sheathing stripped off the bottom, an in anticipation of the first continuation survey, the upper course of bottom from the light line to the boottopping dubbed bright, a treenail driven out from every fourth timber and several from the bottom, all of which proved very satisfactory as well as the timbers and planking thro' which they passed. The bottom caulked and resheathed with Yellow Metal over Felt. P.T.O.

## Present Condition of the

Decks <u>good</u>	Treenails <u>those seen good</u>	Windlass and Capstan <u>good</u>
Waterways <u>where</u>	Breasthooks and Stenson _____	Pumps _____
Comings <u>seen</u>	Transoms, Pointers, and Crutches <u>good</u>	Boats _____
Upper Deck Beams & Fastenings <u>firm</u>	Timbers of the Frame at the openings _____	Masts, Yards, &c. <u>efficient</u>
Lower Deck Beams & Fastenings <u>seen</u>	Ditto Ditto at other places _____	Condition, how ascertained <u>by insp<sup>n</sup> &amp; insp<sup>n</sup></u>
Planksheers <u>good</u>	Keelsons <u>where</u>	Sails _____
Sheerstrakes <u>seen</u>	Clamps and Shelves _____	Anchors No. of <u>3 B 1 S 2 K</u>
Topsides <u>seen</u>	Ceiling <u>seen</u>	Cables _____
Wales _____	Rudder _____	Hawsers and Warps <u>efficient</u>
Plank (Bottom) and Counter <u>caulked and examined</u>	Copper <u>I &amp; Y M</u> When put on <u>now</u>	Standing & Running Rigging _____

## General Observations and Opinion,

Caulking of Bottom, Deck, & Waterways. good where tested

She is now where seen in good and efficient condition, fit in our opinion to remain as classed 7 A. 1.

The Amount of Fee.....£ 7 : 17 : 6 is received by me,  
Testing/aulking  
Special..... 1 : 1 : 3

Certificate (if required) \_\_\_\_\_

Committee's Minute 25<sup>th</sup> February 18 68

Character assigned 7 A. 1.

record Y M was



© 2019

Lloyd's Register Foundation

LON653-0069



28990 *Lon.*

an Iron breast-hook added, and a flat plate  
fitted and bolted to a wooden breasthook  
under the lower deck -

J. J. Cornish



© 2019

Lloyd's Register  
Foundation