

30108

REPORT of SURVEY for REPAIRS.

No. in Reg. Book. **No.** 308 Survey held at London Date Feb^y 2nd 18 69
 on the S. "Robert Morrison" Master _____
 Tonnage 610 Built at Sunderland When built 1853
 By whom built _____ Owners Wilson & Co
 Port belonging to London Destined Voyage _____
 If Surveyed Afloat or in Dry Dock Princes dock & London dock

New 11. 2. 69

Last Survey, No. 28857 Port London Classed 13 A 1

REPAIRS

Cont 66 - 9 10.67

Plank sheers renewed and the main waterway doubled with 4 in Teak, Sheerstrakes and topsides bolted vertically, twenty-four roughtruss new of Iron Bark, & roughtruss rails and channels renewed, fore mast step new of Greenhart, Topsides and waterways recaulked -

Added, four pairs of diagonal riders $4\frac{1}{2} \times 2\frac{1}{4}$ extending from upper deck clamps to take two bolts in the floors -

Present Condition of the

Decks	Treenails	Windlass and Capstan
Waterways	Breasthooks and Stenson	Pumps
Comings	Transoms, Pointers, and Crutches	Boats
Upper Deck Beams & Fastenings	Timbers of the Frame at the openings	Masts, Yards, &c.
Lower Deck Beams & Fastenings	Ditto Ditto at other places	Condition, how ascertained
Plank sheers	Keelsons	Sails
Sheerstrakes	Clamps and Shelves	Anchors No. of
Topsides	Ceiling	Cables
Wales	Rudder	Hawsers and Warps
Plank (Bottom) and Counter	Copper <u>T. S. M.</u> When put on <u>1857</u>	Standing & Running Rigging
General Observations and Opinion,	Caulking of Bottom, Deck, & Waterways.	

Good

Good

Good & sufficient

good where tested

This vessel is eligible in my opinion to remain as classed A 1

The Amount of Fee.....£ 2 : - : - is received by me,

Special..... 1 : 1 : -

Certificate (if required)

Thos. W. Wain

Committee's Minute 11th May 18 69

Character assigned Cont^d 9 12 1

Record Repair



LON 654-0276