

Report of Survey for Repairs of Engines and Boilers.

(37456)

Survey held at London Date, first Survey 15th August Last Survey 18
on the S.S. Vansua Master _____
at 876 When built _____
995 Owners J. Hurckhous Port belonging to London Classified _____
Years assigned. 100 A1
Character in Register Book.

Diameter of Cylinder 30 1/2 Engines made at Newcastle When made 1872
Length of Stroke 33 By whom made Palmer's Co
Pressure of Steam 75
Registered Horse Power 190

Particulars of Repairs and Examination. Cylinders examined, new Valve
Gice fitted to HP cylinder, new crank shaft fitted
Link motion overhauled, Sea cocks ground in,
propeller taken off & shaft drawn, propeller boss
refitted on shaft and 4 new blades put on.
Boilers examined and found in fair condition
3 patches required & fitted to combustion chamber
backs, bottoms of boilers caulked. Safety
valves overhauled. Donkey Boiler examined
& cleaned.

The machinery is now in good order & safe
working condition.

The Amount of Fee ... £ See attached received by me,
Certificate (if required) ... £ Report 187
(Travelling Expenses, if any, £ _____)

James T. Milton
Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

Committee's Minute 27th August 1878




© 2021

Lloyd's Register
Foundation

LON603-0126

It is submitted that
this record is eligible
have a certificate
granted & Lloyd's
Inc. 8-28-1900
J.M. 2/8/78
B

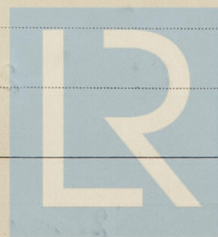

© 2021

Lloyd's Register
Foundation