

# REPORT of SURVEY for REPAIRS, &c.

No. 39445

No. in Survey held at  
Reg. Book.

London

Date, first Survey

Sept

(Received at London Office, 2. 11. 80)  
Last Survey 30 Dec 1880

1356 on the Bk "Josta Rica Packet"

Master & Cory

TONNAGE under Tonnage Deck

Ditto of Spar Deck, or Awning Deck

Ditto of Poop

Ditto of Raised Qr. Dk.

Ditto of Houses on Deck

Ditto of Forecastle

Gross Tonnage

Crew Space, as per Rule

Register Tonnage, cut on Beam

Engine Room

Reg. Tons as St'mer, cut on Bm.

Built at

Guernsey

When built

YEAR.

1861

MONTH.

Owners

L. Lacheur

Port belonging to

Guernsey

Residence

By whom built

Sabine

Destined Voyage

Not fixed

If Surveyed Afloat or in Dry Dock

(State Name of Dock)

Nelson dry dock & Afloat

Length of Poop

ft. Ditto, Forecastle

ft. Ditto, Raised Quarter Deck

ft.

Years assigned.

Character in Register Book.

Last Survey, No.

38461

Port

London

Classed

17A 19.79

Cont June 19. 11

REPAIRS, OR EXAMINATION AS PER RULE

Cause of Repairs to be clearly stated.

Through damage by fire

2 new Quarter Deck Beams & S. Teak. one dressed down and planed. new front to Quarter Dk. one length of Quarter deck Waterway. Shelf piece and 6 shakes of ceiling on the Starboard side of S. Teak. one length of lower deck Waterway Apr of S. Teak. one length of Quarter deck plank sheer. Sheer-shake and shake next below it of S. Teak. new hizen part-ners. Bosby hatch &c. new bits above the hizen hatch. new deck ceiling Port side dressed down. planed & bolts cut and released. new Quarter Deck 2" 4" 1/2" fastened one half beam & ceiling to Apr Hatch & S. Teak. new main deck ceiling Starboard side dressed down. likewise 4 main Deck Beams dressed down & planed. new main Deck 3 1/2"

Present Condition of the

Decks

Good

Treenails

Good

Windlass and Capstan

Good

Waterways

Breasthooks and Stemson

Pumps 2 chain & 2 helix

Comings

Transoms, Pointers, and Crutches

Boats 3 nos

Upper Deck Beams & Fastenings

Timbers of the Frame at the openings

Masts, Yards, &c.

Lower Deck Beams & Fastenings

Ditto Ditto at other places

Condition, how ascertained from Deck

Plank sheers

Keelsons

Sails 2 suits

Sheerstrakes

Clamps and Shelves

Anchors No. of 3 B. 1 S. & 2 H.

Topsides

Ceiling

Cables part seen Good

Wales

Rudder

Hawsers and Warps 3 nos & 2 chain chain

Plank (Bottom) and Counter

Caulking of Bottom, Deck, & Waterways

Standing & Running Rigging

Engine Room Skylights

Coal Bunker, Openings, Lids, &c.

Scuppers

Cargo and Main Hatchways Good Hatches Good

General Observations, Opinion as to Class, &c.

She is now in good condition and in my opinion eligible to continue as Classed

The Amount of Entry Fee ...

2/1/80 Special ...

received by me,

1880

Certificate (if required)

to be sent as per margin...

(Travelling Expenses, if any, £)

Committee's Minute

Tuesday, November, 2nd 1880.

Character assigned

Cont 11 1/2

Record damage upon

ROBT. EDMD. TAYLOR & SON, Commercial Steam Printers, 19, Old Street Goswell Road, London.

Will A. C. Darcy

Surveyor to Lloyd's Register of British and Foreign Shipping.



© 2021

Lloyd's Register Foundation

LON664-0498



397752

Y.P. Yellow M fastened. After Hatches & Grating hatches also new.

2 Sptimbers in Raised Quarter Deck of Eng<sup>h</sup> Oak  
& Moning Chocks renewed.

New work caulked and outside plating metal from main  
Rigging Apr

Not of damage -

Main Deck from main Hatchway forward  
new of 3 1/2 Ym. Yellow metal fastened - thus completing  
all new decks.

Wm<sup>m</sup> B. Davey



© 2021

Lloyd's Register  
Foundation