

40858

Report of Survey for Repairs of Engines and Boilers.

No. _____ (Received at London Office, 10/10/81)

No. in Reg. Book. 408 Survey held at London Date, first Survey 11 Aug Last Survey 28th Sept 1881

408 on the Machinery of the S.S. "John Pender" (Number of Visits 6)

Tonnage, Gross 1213 Built at Inverkeithing When built 1875
 Ditto, Net 706 Owners Eastern Telegraph. Co. Port belonging to London
 Diameter of Cylinder 27 1/2 48 1/2 Engines made by J. Scott & Lons. When made 1875
 Length of Stroke 36 Boilers made by " When made 1875
 Pressure of Steam 40 If Surveyed Afloat or in Dry Dock Pender D. Sh. & afloat. (State name of Dock.)
 Registered Horse Power 98 Classed 90 A1
 Last Survey No. _____ Port _____ Lloyds M.C. 4.77

Particulars of Repairs and Examination Special Survey and Damage

Examined Sea cocks & Connections. Corrosion had commenced near one of the blow off cocks, recommended a brass washer to be fitted on outside of plating which has been done.

Examined tunnel stuffing crankshaft cylinders, and pumps which were in good condition except thrust block & staff; the collars on staff have been turned true & new brass ring fitted to thrust block. The propeller & tunnel stuffing have been refitted.

The tubes in the boilers have been removed & new one fitted in their place. The boilers appear to be in a good condition. The safety valves (weighted) are in good working order.

Found ballast donkey discharge pipe cracked. A new one has been fitted.

General Observations, Opinion, and Recommendation:— As far as seen the machinery of this vessel appears in safe working condition and eligible in my opinion to have the notification Lloyd's M.C. 9.81 recorded in the Register Books

Damage £ 2.2. -
 Entry or Registering Fee... £ 1.0.0
 Survey Fee (per Section 28) ... £ 4.4. - received by me, C. E. Kronmayer
 Certificate (if required) ... £ 2.0.0 1881
 (Travelling Expenses, if any, £ _____)

Committee's Minute Tuesday, October, 11th 1881.
 Assigned Lloyd's M.C. 9.81
 Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.



Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.

Insert Character precisely as in the Register Book.

LON 666-0592

It is submitted that this vessel is
eligible to have the certification
Lloyd's M.C. 9. 81 records subject to
the policy being renewed
when 6 years old as per
Rule

M 11/10/78



© 2021

Lloyd's Register
Foundation