

# REPORT of SURVEY for REPAIRS, &c.

41560

No. 773 in Survey held at London Date, first Survey May 10<sup>th</sup> Last Survey May 30<sup>th</sup> 1882  
 Reg. Book. SS Ananda (No. of Visits 9) Master Cramer  
 TONNAGE under Tonnage Deck 345 Built at Greenock When built 1871  
 Ditto of Spar Deck, or Awning Deck \_\_\_\_\_ Owners Burma Steam Ship Co Port belonging to Greenock  
 Ditto of Poop \_\_\_\_\_ Residence \_\_\_\_\_  
 Ditto of Raised Qr. Dk. \_\_\_\_\_ By whom built Caird Destined Voyage Lisbon  
 Ditto of Houses on Deck \_\_\_\_\_ If Surveyed Afloat or in Dry Dock Pontoon Victoria St & afloat  
 Ditto of Forecastle \_\_\_\_\_ (State Name of Dock) \_\_\_\_\_  
 Gross Tonnage 357 Length of Poop \_\_\_\_\_ ft. Ditto, Forecastle \_\_\_\_\_ ft. Ditto, Raised Quarter Deck \_\_\_\_\_ ft.  
 Crew Space, as per Rule \_\_\_\_\_ Years assigned \_\_\_\_\_ Character in Register Book \_\_\_\_\_  
 Register Tonnage, cut on Beam \_\_\_\_\_  
 Engine Room \_\_\_\_\_  
 Reg. Tons as St' mer, cut on Bm. 222  
 Last Survey, No. 103 Port Lug Classed 900 F. 4.81  
 REPAIRS, OR EXAMINATION AS PER RULE SS Eng No 2, 79.  
 Cause of Repairs to be clearly stated.

*This vessel went on the Pontoon to coast the bottom & annual survey, on examination the Intercoastal keelson in the after hold in some of the spaces between the floors were wasted away, also some of the floors the same. The floors have been doubled butting in the middle line but no butt straps on the them. The sheerstake in the Starboard coal bunker was wasted through and a piece has been put into it about 3 ft long & about 2 ft deep, being about 1 no stage <sup>being made the size</sup> could not be exactly taken. The reversed bars on the frames where they could be seen in the coal bunkers are wasted. For further particulars see letter attached*

Present Condition of the	Treenails	Windlass and Capstan
Decks	Breasthooks and Stemson	Pumps
Waterways	Transoms, Pointers, and Crutches	Boats
Comings	Timbers of the Frame at the openings	Masts, Yards, &c.
Upper Deck Beams & Fastenings	Ditto Ditto at other places	Condition, how ascertained
Lower Deck Beams & Fastenings	Keelsons	Sails
Plank	Clamps and Shelves	Anchor No. of
Wa	Ceiling	Cables
Plank (Bottom) and Counter	Rudder <u>Bushed</u>	Hawsers and Warps
Engine Room Skylights	Copper (or Y.M.) _____ When put on _____	Standing & Running Rigging
Coal Bunker, Openings, Lids, &c.	Caulking of	
Scuppers	Bottom, Deck, & Waterways	
Cargo and Main Hatchways		
Hatches		

General Observations, Opinion as to Class, &c.

*As the necessary repairs have not been done to entitle her to classification we are unable to submit her to the favourable consideration of the Committee*

*Senhouse Martindale*  
*Wm C. Seavey*  
 Surveyor to Lloyd's Register of British and Foreign Shipping.

The Amount of Entry Fee ... .. £ : : received by me, }  
 Special ... .. £ : : 188 }  
 Certificate (if required) } £ : :  
 to be sent as per margin... }

Committee's Minute Friday, 9th June, 1882.  
 Character assigned Expunged Character  
 19/182

