

Report of Survey for Repairs of Engines and Boilers.

No. _____ (Received at London Office, _____)

No. in Reg. Book. Survey held at London Date, first Survey Sept. 26th Last Survey Oct. 9th 1882.

218 on the Machinery of the S. S. "Pelaw" (Number of Visits 5)

Tonnage, Gross 79.3 Built at Sunderland When built 1869

Ditto, Net 59.3 Owners Comm. S. M. Ship Co. Port belonging to London

Diameter of Cylinder 38" Engines made by N. & L. Marine Co. When made 1869

Length of Stroke 30" Boilers made by _____ When made 1879

Pressure of Steam 45 lbs. If Surveyed Afloat or in Dry Dock afloat & in Dry Dock Years assigned 95 Character in Register Book A1

Registered Horse Power 90 (State name of Dock.)

Last Survey No. _____ Port L.M.C. 4.79.M.S.1281

Particulars of Repairs and Examination For Special Survey No 3.

(State cause of Repairs.)

Examined cylinders which were found in good condition. The pistons have been turned up in lathe, new packing rings & new springs have been fitted. Slide valves & faces found to be in good condition. Crank shaft examined. Three out of the four webs of the crank found to be badly flawed round the fillets, recommended two new halves of shaft to be fitted which has been done. Air circulating feed & bilge pumps overhauled & repaired.

Boiler examined internally & externally found to be in good condition. Safety valves examined " " "

" " Donkey Boiler " " "

" " Safety valves tested under steam found to lift at 45 lbs. per sq. in.

General Observations, Opinion, and Recommendation:— The machinery being now in good & safe working condition renders the vessel eligible in my opinion to be marked with L. M. C. 10. 82.

Entry or Registering Fee... £ 1 : 0 : 0

Survey Fee (per Section 27.) 1. 10. 0

Survey Fee (per Section 28) ... £ 3 : 3 : 0

Certificate (if required) ... £ 2 : 0 : 0

(Travelling Expenses, if any, £ _____)

Committee's Minute _____

Assigned _____

received by me, G. Q. Milner 9th Nov. 1882

Engineer Surveyor to Lloyd's Register of British & Foreign Shipping.

20/10/02 188

L M C 10. 82

(State if Report is also sent on the Hull of the Ship _____)

(Condition of Engines and Boilers, and subsequent Repairs and Examinations, to be clearly stated.)

(Insert Character precisely as in the Register Book.)

102669-0152

Submitted that this vessel
is eligible to have Lloyd's
M.C. 10.82.

M 17. 10. 82



© 2021

Lloyd's Register
Foundation