

3/3/86

Damage Repairs.
REPORT of SURVEY for REPAIRS, &c.

Received in London Office,

TUESDAY 16 MARCH 1886

No.

No. in
Reg. Book.

Survey held at

London

Date, First Survey

18th Feb^y Last Survey 5th March 1886

(No. of Visits)

Master R. Lockerton

YEAR.

MONTH.

TONNAGE:—

Built at

Kinghorn

By whom

J. Key

When 1877

NET 445

Owners

Gammion & Carter

Port belonging to London

GROSS 715

Owner's Address

(if not already recorded in Appendix to Register Book.)

UNDER DK. 542

If Surveyed Afloat or in Dry Dock

Name of Dock

Union Dry St

Destined Voyage

Coal Trade

Length of Poop

ft.: of Forecastle

ft.: of Raised Or. Deck

ft.: Moulded Depth

ft.

ins.

(if these particulars are not yet recorded in the Register Book.)

Years assigned,
if a Wood Ship.

Character in
Register Book.

Classed

Last Survey, No.

5966

Port

Lik

90 A 1.7.85
SS Lm M 1-83.

(State clearly the cause of Repairs if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and Initials of any letters respecting this case.)

Society's Freeboard
(if assigned)
as painted on Ship

in salt water

ft.

ins.

in fresh water

ft.

ins.

REPAIRS, OR EXAMINATION AS PER RULE

At present placed in the dry dock the bottom

cleared and examined. Repairs owing to Damage.

Port Bilge forward one indented plate taken off and

6 frames, reverse do and floors repaired in work of same

plate fairer and put back again. A few spaces of frames

abaft ditto one floor, frame & reverse do repaired.

Port Bilge aft 5 indented or damaged plates taken off and replaced

them with new plates. one harbour plate taken off repaired &

put back again. Heated & fairer one indented on side, one

frame repaired & heated & fairer the floor plate. Also heated one other

frame & floor & put a boom angle on frame.

Starboard Bilge forward 4 indented or damaged plates taken off.

repaired 13 frames, reverse frames & floors in double bottom, & doubling

plates put on same of the floors. Heated and fairer 3 of the plates

taken off & replaced them, one plate removed. Many of the rivets inside

double bottom and in the girders angles renewed. one doubling plate put on quarter

PRESENT CONDITION OF THE

Decks	Good	Plank (Bottom) & Counter	Good	Ceiling	Good	Boats	Good
Waterways	"	Trunnions or Rivets	"	Rudder	"	Masts, Yards, &c.	"
Comings	"	Breasthooks and Stemson	"	Windlass & Capstan	"	Condition, how ascertained	From St
Up'r Dk. Beams & Fastenings	"	Transoms, Pointers, & Crutches	"	Pumps	"	Sails	Good
Low'r Dk. Beams & Fastenings	"	Timbers of Frame at the openings	"	Cement (If Iron Ship)	"	Anchors	No. of 3 Bros. & 2 his
Planksheers	"	Ditto ditto at other places	"	Caulking of Bot'm, D'k, & Watrways	"	Cables	Part on St
Sheerstrakes	"	Keelsons	"	Copper, or Y.M.	"	Hawsers & Warps	"
Topsides	"	Clamps & Shelves	"	(State if on Felt.)	"	Standing & Running Rigging	"
Wales	"			When put on	"	Hatches	"
Engine Room Skylights	Good	Coal Bunker, Openings, Lids, &c.	Good	Scuppers	Good	Cargo & Main Hatchways	Good

General Observations, Opinion as to Class, &c.:

She is now in an efficient state
and eligible to remain as classed.

Next Half-yearly Report attached

Sanhouse Martindale.

Entry Fee (if chargeable) per Scale I., Sec. 27.	£	:	:	received by me 8/4/86 E.H.J.
Office Fee (if chargeable) per Scale II., Sec. 27.	£	:	:	
Survey Fee (per Section 28) 27/2/86	£	3	3	
Special Damage Fee (if any) (per Sec. 28).....	£	:	:	
Certificate (if required) to be sent as per margin	£	:	:	
Travelling Expenses (if chargeable)	£	:	:	
Second Surveyor's Fee (if any)	£	:	:	

Committee's Minutes

TUESDAY 30 MARCH 1886

Character assigned

90 A 1.7.85
D.M.P.

Surveyor to Lloyd's Register of British & Foreign Shipping.



Lloyd's Register
Foundation

Many of the rivets in the Keel renewed.
The cement renewed in way of Repairs.

The ceiling removed off the fore and after
double bottoms and the oxidation shipped off
the top plates and coated, and both double bottoms
made tight & tested up to light time, and the ceiling
relaid. Bottom &c coated

Senhouse Martindale



© 2021

Lloyd's Register
Foundation