

Report of Survey for Repairs, &c., of Engines & Boilers.

47147

(Received at London Office,)

No. _____ Port of _____
 No. in Survey held at London Date, first Survey Mar. 15 Last Survey Mar. 24 1887
 Reg. Book. on the Machinery of the S.S. "Martin" (Number of Visits 2)
 Year Month

Tonnage, Gross <u>995</u>	Built at <u>Newcastle</u>	When built <u>1875-5</u>
Ditto, Net <u>641</u>	Owners <u>G. S. N. Co.</u>	Port belonging to <u>London</u>
Diameter of Cylinder <u>33 & 62</u>	Engines made by <u>Thompson & Co.</u>	When made <u>1875</u>
Length of Stroke <u>36</u>	Boilers made by <u>Do.</u>	When made <u>1875</u>
Pressure of Steam <u>65 lbs.</u>	Surveyed Afloat <input checked="" type="checkbox"/> in Dry Dock <u>G. S. N. Co.</u>	Classed <u>100 A1</u>
Registered Horse Power <u>180</u>	(State Name of Dock.)	Character in Register Book.
Last Survey No. _____	Port _____	<u>LM.C.Q. 33 B.S. 1185.</u>

Particulars of Repairs and Examination In Annual Survey
 (State clearly the cause of Repairs if any, and in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage should be separated from Repairs due to other causes. State also the dates and initials of any letters respecting this case.)

Vessel placed in dry dock, sea connections examined & found in good condition. Propeller disconnected, tail shaft drawn, examined found in good condition, the stern bush renewed & the propeller replaced. Main boilers examined, new lower part plates have been fitted to shell of boilers, some defective joints in shells under bottom have been renewed & plates caulked, the remainder of boilers in good condition. Safety valves in good condition. Main boiler satisfactorily tested with hyd. press. to 110 lbs. Wreck boiler in good condition. Safety valve in good condition & loaded with a direct weight to 40 lbs. &

General Observations, Opinion, and Recommendation: -- *The boilers being now in good safe working condition the vessel is eligible in my opinion to remain as classed than the notification B.S. & 87 recorded provided that the boilers are again examined within 12 mths. as per rule.*

Office or Registration Fee (per Sec. 27).....	£ : :	} received by me, 5.5.1887
Survey Fee (per Section 28)	£ 2 : 2	
Special on Damage, Fee (per Section 28)	£ : :	
*Certificate (if required) to be sent as per margin..	£ : :	
Travelling Expenses (if chargeable).....	£ : :	

Geo. P. Wilkinson
 Engineer Surveyor to Lloyd's Register of British and Foreign Shipping.

Committee's Minute TUESDAY 28 APRIL 1887
 Assigned B.S. & 87

Form No. 3 - 1887. The Surveyors are requested not to write on or below the space for Committee's Minute.

Insert Character of Ship and Machinery precisely as in the Register Book.

LON 686-0035



It is submitted that this vessel
is eligible to have the notification
B.S 3-87 recorded the boilers
being subject to resurvey as
per Rule.

W.P.
18/4/87



© 2021

Lloyd's Register
Foundation