

50257

FRIDAY 31, JAN 1896

State if a Report is also sent on the Machinery of the Ship
or if not whether, and when, one will be sent.

Insert Character precisely as in Register Book.

Surveyor to Lloyd's Register of British & Foreign Shipping.

British & Foreign Sh

Lloyd's Register
Foundation

Lon688 - 0284

50257 Lon.

second beam partly renewed and strengthened, and the third beam straightened. The foremost forecasse deck stringer plates on each side renewed, and the whole of the gunwale angle iron on the Port side, and a portion of that on the Starboard side also renewed. A painting plate and breast plate in the forecasse, and a painting plate to the first pair of frames, below the main deck, renewed. The fore part of the main deck stringer and angles there renewed. The half round iron forecasse gunwale moulding renewed on each bow for about 14 feet. The deck flanges to the house pipes on the forecasse deck renewed. A portion of the forecasse deck renewed, and the deck recaulked. The port cast iron fair lead at the stern head renewed. The anchor crane repaired. The ground chains at the fore part of the forecasse repaired. The port anchor stopper repaired. A new sheave fitted to the jumper stay to foremast on stern head, and the fair lead to the foretopmast stay repaired.

A new length of chain cable has been supplied to the vessel in place of one length of the port cable damaged, but the undersigned had no opportunity of examining and comparing it with the Test Certificate, but an opportunity will be afforded for doing this when the vessel is next in London.

Chas. H. Jordan