

Office Fee (if chargeable) per Scale II., Sec. 27 .....	£				Fees applied for,
Survey Fee (per Section 28) .....	£				16/2/1893
Special Repair Fee (if any) (per Sec. 28.) .....	£	2	2		Received by me, 2/12/93 <i>[Signature]</i> 21
Travelling Expenses (if chargeable) .....	£				18/93
Second Surveyor's Fee (if any) .....	£				
Certificate now required? .....					
Committee's Minute					
Character assigned					
No. &c.					

FRI 17 FEB 1893
L
Lloyd's Register  
Foundation

+LMC2,93
No. 1-92
LONB98-0152



5400. In

The outer strake - - - - - One plate removed faired & replaced.

do - - - - - one plate removed

do - - - - - one doubling plate removed

do - - - - - do removed faired & replaced

1<sup>st</sup> strake below the above one plate " " & "

4 Frames entirely removed & renewed -

To facilitate the removal of these frames, the <sup>partly</sup> rivetting in 2 plates in the 2<sup>nd</sup> strake below the outer strake, loosened, & one plate in the 3<sup>rd</sup> strake below the above removed, these <sup>were afterwards</sup> rivets removed & the plate replaced.

2 Deck beams repaired, 1 Boiler stay to ship's side removed 20 ft. of main deck stringer bar, & several legs renewed -

1 Side stringer plate removed, & one cut back 4 feet;

2 doubling plates over these removed & replaced -

### Other Repairs

5 Indentations in various parts of the shell faired, one plate in E strake 2<sup>nd</sup> from stem star side removed a half round iron rubbing strip fitted on the star side; this is to prevent undue wear & tear on this side when at the usual dis-charging berth.

### Completion of P.D. No 1

In order to fulfill the recommendations made in the Lon Rep<sup>t</sup> No 53087, the bunkers, holds & belges, in the E & B. space have been scaled, examined & coated. They are now in good condition.

Gaurence Gibson