

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report.

18. When handed in at Local Office

19. Port of London

No. in Reg. Book.

Survey held at London

Date, First Survey 5th July Last Survey 31st August 1893
(No. of Visits) 16th year

527 on the Wood, Iron or Steel Bk 'Franklin'

Master - George

TONNAGE:-

GROSS 1438

Built at Tool Glasgow By whom J. Reid & Sons

UNDER D.K. 1309

Owners of Whittingham

When 1868 10/

NET 1383

Owners' Address

Port belonging to Melbourne

(not already recorded in Appendix to Register Book.)

Surveyed Afloat or in Dry Dock?

Name of Dock & place dry dock Destined Voyage Australia

WB= DBa

tons; f tons; uE&B tons; CellDB tons; tons;

FPT tons; APT tons; MT tons.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

N.B. - All alterations in the existing records should be underlined.

CHARACTER.

* for Special Survey.
Date of last Survey and of Periodical Surveys.

Year now expired

Machinery and Boiler Surveys (including date of N.B., if any).

** Part I.

S.S. Lon. N° 3 9. 88

6. 92

Society's Freeboard (if assigned) as painted on ship and now verified

4 ft. 8 1/2 ins.

Last Survey, No. 87152 Port London

(Periodical Surveys, when held, must be reported in detail and verbatim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors, Chains, or Hawsers is reported, the particulars of weight or size and test of the articles should be clearly stated, and also the weight or size, &c., required by the Rules, together with the vessel's Equipment Letter, if any. State also the dates and initials of any letters respecting this case.)

REPAIRS, OR EXAMINATION AS PER RULE, FOR S.S. N° 1 & Damage through stress of weather.

The vessel placed in dry dock bottom & mudder examined, cleaned & painted, timber bonds & ceiling in excess of Rule requirements removed, cement examined & iron work in bottom cleaned & cement washed, holds cleaned & painted, toe peak examined & found to have been recently cleaned & painted decks varnished, windlass & steering gear overhauled and masts, spars & general equipment attended to. Masts & boomsprit wedges removed.

Ordinary repairs now done - Main deck doubled with 2" Oregon pine from fore part of deck house to forecastle comings & 8 planks removed at other parts of the deck. New rider plate fitted to centre keelson in way of after hatch & chain shot & ties repaired.

Repairs on account of damage - Now done, main deck beam knees for about half length midships on each side relived, three cracked panes in the teak decks repaired, seven twin banchions renewed and a number of started

SUMMARY OF DAMAGE REPAIRS: Plates, Faired or Repaired; ✓ Frames, ditto. ✓ Plates, Renewed; ✓ Frames, ditto. Other Repairs. *Some knees amadized, wood replaced, & plates renewed.*

PRESENT CONDITION OF THE

Decks	Good	Transoms, Pointers, & Crutches	Good	Copper, or T.M. (State if on Pelt.)	Good	Hatches	Good
Watertight	"	Timbers of Frame at the openings	"	When put on, Month Year	"	Boats	"
Comings	"	Do. ditto at other places	"	Rudder	"	Masts, Yards, &c.	"
Up'r Dk. Beams & Fastenings	"	Kneelons	"	Windlass & Capstan	"	Condition, how ascertained by examination	"
Low'r Dk. Beams & Fastenings	"	Chains, Shafts & Stringers	"	Pumps	"	Sails	"
Plating	"	Salting (State if examined.)	"	Engine Room Skylights	"	Equipment letter	"
Decking	✓	Ceiling	"	Coal Bunker, Open'gs, Lids, &c.	"	Anchors, No. of	3 Bo 1 Sp + 2 Kgs
Transom Rivets	Good	Gummit or Asphalt (State which.)	"	Scuppers	"	Cables (state if none ranged)	2 ft. 6 in.
Breaststocks & Stemson	"	Tanks (State if now tested.)	"	Cargo & Main Hatchw'y's	"	" length 285 ft. size 1 1/4 x 1 1/4	"
		Caulking of Bot'm, Dk, & Wat'rwy's	Good			" Bule length 270 size 1 1/4	" Hawsers & Warps
							" Standing & Running Rigging
							sufficient

General Observations, Opinion as to Class, Recommendation, &c.

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example: "to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 9.91," or "to remain as classed and to have record of survey, 9.91, and the notations of N. 31 and P. N. 31, &c."

This vessel is now in good and efficient condition and in our opinion eligible to remain as classed and to have record of survey 93 and the notation of S.S. Lon. N° 1-93 in the Register Book.

Office Fee (if chargeable) per scale II, Sec. 27 £

Fees applied for,

Survey Fee (per Section 28) £ 4. 10. 00 7/9/1893

Special Damage or Repair Fee (if any) £ 4. 4. 00 Received by Mr. 14/9/1893

Travelling Expenses (if chargeable) £ : :

Second Surveyor's Fee (if any) £ : :

Is Certificate now required? £ : :

Committee's Minute

Character assigned

C Buchanan -

R. T. Johnson

Surveyor of Lloyd's Register of British & Foreign Shipping.

FRI 8 SEP 1893

SS. N° 1-93 Sep 93

Port of London

Continuation of Report No. 54701 dated

on the

Bk "Ivanhoe"

started rivets in the topside plating renewed, several bulwark stanchions on each side amidships repaired & staves of deck in way of same removed; ciment in waterways repaired. Rails, bulwarks, boats, boats skids & fittings overhauled & repaired.

Spars. fore mast ^{taken} out of ship, new cheeks fitted & hettle trees fitted, a number of started rivets at mast head renewed & heel strengthened. Fore topmast renewed with fitted pine. Fore topgallant mast " " " " " main topmast " " " " " fittings to masts and yards overhauled & repaired generally.

C. Buchanan.

PRINTED IN U.S.A. BY AMERICAN CYANAMID COMPANY