

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report 11/12/94 When handed in at Local Office 11/12/94 Port of London
 No. in Survey held at London Date, First Survey 1/12/94 Last Survey 8/12/94
 Reg. Book. 671 on the Merchantman Steel S/S 'City of London.' Master J. Berry
 TONNAGE:— Built at Newcastle By whom, Schlesinger & Davis When 1891-12
 GROSS 351 Owners D.C. Thomas Sons Port belonging to London
 UNDER D.K. 262 Owners' Address Surveyed Afloat or in Dry Dock? Dry Dock Name of Dock Union Dry Dock Destined Voyage Brussels
 NET 180 (if not already recorded in Appendix to Register Book.)
 WB=DA 1 tons; f 1 tons; uE&B 1 tons; CellDB 1 tons; { Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).
 FPT 1 tons; APT 17 tons; MT 1 tons.
 N.B.—All alterations in the existing records should be underlined.
 If the vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

CHARACTER.	Years Assigned now, if any.	Machinery and Boiler Surveys (including date of N.E., if any).
For Special Survey, Date of last Survey and of Periodical Surveys.		

* 100 A.I. Thru 12/94
 9/94

Last Survey, No. 57838 Port Lon

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors, Chains, or Hawser is reported, the particulars of weight or size and test of the articles should be clearly stated, and also the weight or size, &c., required by the Rules, together with the vessel's Equipment Letter, if any. State also the dates and initials of any letters respecting this case.)

REPAIRS, OR EXAMINATION AS PER RULE, FOR Damage Repairs
 in consequence of the vessel sitting on the sunken
 Barge Ruby at Colonial Wharf (or Granite Wharf) &
 through leaching against the Quay wall, on 8th November
 November 29th 1894
 This steamer was placed in Union Dry Dock Limehouse
 the bottom examined cleaned & coated.
 on the port side amidships, new main rail, 40 feet 8" x 2½" a piece
 1 piece of angle iron rail removed faired & replaced &
 another length faired in place, the stronger angle fixed
 in position. Three bulwark plates dealt with, one in place
 two removed faired & replaced. One sheer strake plate
 removed faired and replaced, & the valves of main
 Donkey Engine re-peaced as before.

(Continued)

SUMMARY OF DAMAGE REPAIRS:— 9 Plates, Fairied or Repaired; 2 Frames, ditto. 1 Plates, Renewed; 1 Frames, ditto. Other Repairs.

PRESENT CONDITION OF THE	Decks	Transoms, Pointers, & Crutches	Copper, or Y.M. (State of Felt.)	Hatches	Boats	Good
Waterways	4	Timbers of Frame at the openings	When put on, Month			
Coamings	4	ditto ditto at other places				
Up'r Dk. Beams & Fastenings	4	Keelsons	Rudder			
Low'r Dk. Beams & Fastenings	4	Gangs, Bulkheads & Stringers	Windlass & Capstan			
Plating	4	Sailing (State if now tested.)	Pumps			
Planking	4	Ceiling	Engine Room Skylights			
Timber & Rivets	4	Cement or Asphalt (State when.)	Coal Bunker, Open'gs, Lids, &c.			
Breasthooks & Stempost	4	Tables (State if now tested.)	Scuppers			
		Caulking of Bot'm, Dk, & Wat'ry's	Cargo & Main H'tch'ys			

General Observations, Opinion as to Class, Recommendation, &c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 9/91," or "to remain as classed and to have record of survey, 9/91, and the notations of ss No. 1-91 and pt ND91, &c."

This steamer now appears to be in a sound & efficient condition, eligible in my opinion to remain as classed, with a fresh record of survey
 Lon 12/94

Office Fee (if chargeable) per Scale II, Sec. 27 £ : : :
 Survey Fee (per Section 28) £ : : :
 Special Damage or Repair Fee (if any) (per Sec. 28) £ : : :
 Travelling Expenses (if chargeable) £ : : :
 Second Surveyor's Fee (if any) £ : : :
 * Is Certificate now required?

Committee's Minute
 Character assigned

Fees applied for,
 Received by me,

FRIDAY 14 DEC 1894

Edward H. Lierney
 Surveyor to Lloyd's Register of British & Foreign Shipping.

© 2019



Lloyd's Register
 Foundation

'City of London'

Port side flooded

Three planks, one in the 1st & 2nd strakes below the sheer strake fairied in place & the seams lined where necessary

The after skid beam to boat removed, repaired and refitted, the skylight to Engine Room removed, repaired & replaced., the boat chocks, boat &c refitted as before

The davit eye to forward skid beam removed, repaired & replaced

The steering gear overhauled & repaired where necessary

A pillar in after hold removed, repaired & replaced & the ceiling in way of same lifted & cement examined

The port gangway doors on fore part of main deck removed, repaired & refitted

Starboard bottom damage:- Two planks nos 8 & 9 in B strake fairied in position, two places in C strake nos 4-8 and one plank in D strake no. 8 removed fairied & repanelled

The cement in the Engine & Boiler space and after hold examined, the loose ceiling in the after hold being lifted for this purpose.

Edward J. Tierney,