

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report 2 July 1895 When handed in at Local Office

No. in Survey held at London.

Reg. Book. 1903 on the Wood, Iron or Steel Bk. "Auriga"

Port of London

Date, First Survey 7 May (No. of Visits) Last Survey 2 July 1895

28

Master Stone.

TONNAGE:

GROSS 540UNDER D.K. 499NET 518

Built at Sunderland. By whom Cliff Mounsey & C. When 1869 9.

Owners J. M. Ritchie

Port belonging to Brunel

Owners' Address

(If not already recorded in Appendix to Register Book.)

Surveyed Afloat or in Dry Dock? ✓ Name of Dock Commercial & Destined Voyage Australian 1895

WB=CelDDBorDBa tons; uE&B tons; f tons; tons; FPT tons; APT tons; MT tons.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

N.B.—All alterations in the existing records should be underlined.

If the vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

Last Survey, No. 40708 Port C.W.

(Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors, Chains, or Hawsers is reported, the particulars of weight or size and test of the articles should be clearly stated, and also the weight or size, &c., required by the Rules, together with the vessel's Equipment Letter, if any. State also the dates and initials of any letters respecting this case.

REPAIRS, OR EXAMINATION AS PER RULE, FOR Special Survey 2/3.

Vessel placed in dry dock bottom examined cleaned and painted. Rudder lifted and pintles rebrushed.

all close ceiling in hold removed, all oxidation beaten and chipped off the ironwork in way of same, and the iron work examined and recoated, the cement examined and repaired in places where necessary, the ceiling relaid, repaired and paint renewed as necessary. The lining in hoop in way of side lights and round stem removed and plating in way of same examined. The iron work in lower hold above close ceiling and in tween decks examined and found in good condition. The peak examined chipped and painted.

The deck renewed of $3\frac{1}{2}$ in repair pine.The chain cable ranged and 15 fathoms of same - $1\frac{7}{16}$ -

SUMMARY OF DAMAGE REPAIRS :—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Other Items :—
Renewed ...						
Faired or Repaired ...						
PRESENT CONDITION OF THE						
Decks	Good	Timbers of Frame at the openings	Good	Rudder	Good	Hatches
Waterways	"	Ditto ditto at other places	"	Windlass & Capstan	I Patent "	Boats
Coamings	"	Keelsons	"	Pump	"	Masts, Yards, &c.
Up'r Dk. Beams & Fastenings	"	Clamps, Shells & Stringers	"	Sluice Valves	"	Condition, how ascertained
Low'r Dk. Beams & Fastenings	"	Salting (State if examined.)	"	Watertight Doors	"	(State if wedges removed) Yes
Plating	"	Ceiling	"	Ding. Plates under Sounding Pipes	"	Sails
Planking	"	Cement or Plaster (State which.)	"	Engine Room Skylights	"	Equipment letter
Transom or Rivets	"	Tank (State if new tested.)	"	Coal Bunker, Open'gs, Lids, &c.	"	Anchors, No. of
Breasthooks & Sternson	"	Caulking of Bot m. Dk. & Wat'rwy's	"	Scuppers	"	Cables (State if now ranged). Yes
Transoms, Paints, & Crutches	"	Copper, or Y.M. (State if on Felt.)	"	Cargo & Main H'tch'w'y's	"	" length 240 ft. size 176 in
		When put on, Month Year				" Rule length 240 " size "
						Hawsers & Warps
						Standing & Running Rigging

General Observations, Opinion as to Class, Recommendation, &c.:

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—".....to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey 91," or "to remain as classed and to have record of survey 91 and the notations of No. 1-91 and ptND91, &c."

This vessel has now complied with the requirements of the rules for Special Survey 2/3, she is in good and efficient condition and eligible in our opinion to remain as classed with the record
S.S. hon. 2/3-7.95" "R. 5 95"

Office Fee (if chargeable) per Scale II, Sec. 22 £

Survey Fee (per Section 28) £ 6 : 0 : 0

Special Damage or Repair Fee (if any) less 10% £ 12

Travelling Expenses (if chargeable) £ 5 8

Second Surveyor's Fee (if any) £

Committee's Minute FPT 5 JULY 1895

Character assigned A 1SS 2/3 7.95N.D. 95

Fees applied for,

5 JULY 1895

Received by me,

5. 7. 1895

E. B. Champness

W. M. Morley

Surveyor to Lloyd's Register of British & Foreign Shipping.

© 2019

W. M.

8/9/19

Lloyd's Register

Foundation

LON705-04551

5 JUL. 95


on the

Iron Bk. "Auriga"

renewed certificate No 1638 dated Betherston 15th March 1894,
Tests 37.2.2.0 & 55.12.2.0 S. J. Lewis Esq.

Pumps & sluice examined, marsh wedge removed,
marsh spars and rigging overhauled, one plate of main
marsh in way of wedging found chafed and now doubled.

The fine topgallant and main lower yard
renamed of spruce & pitch pine.

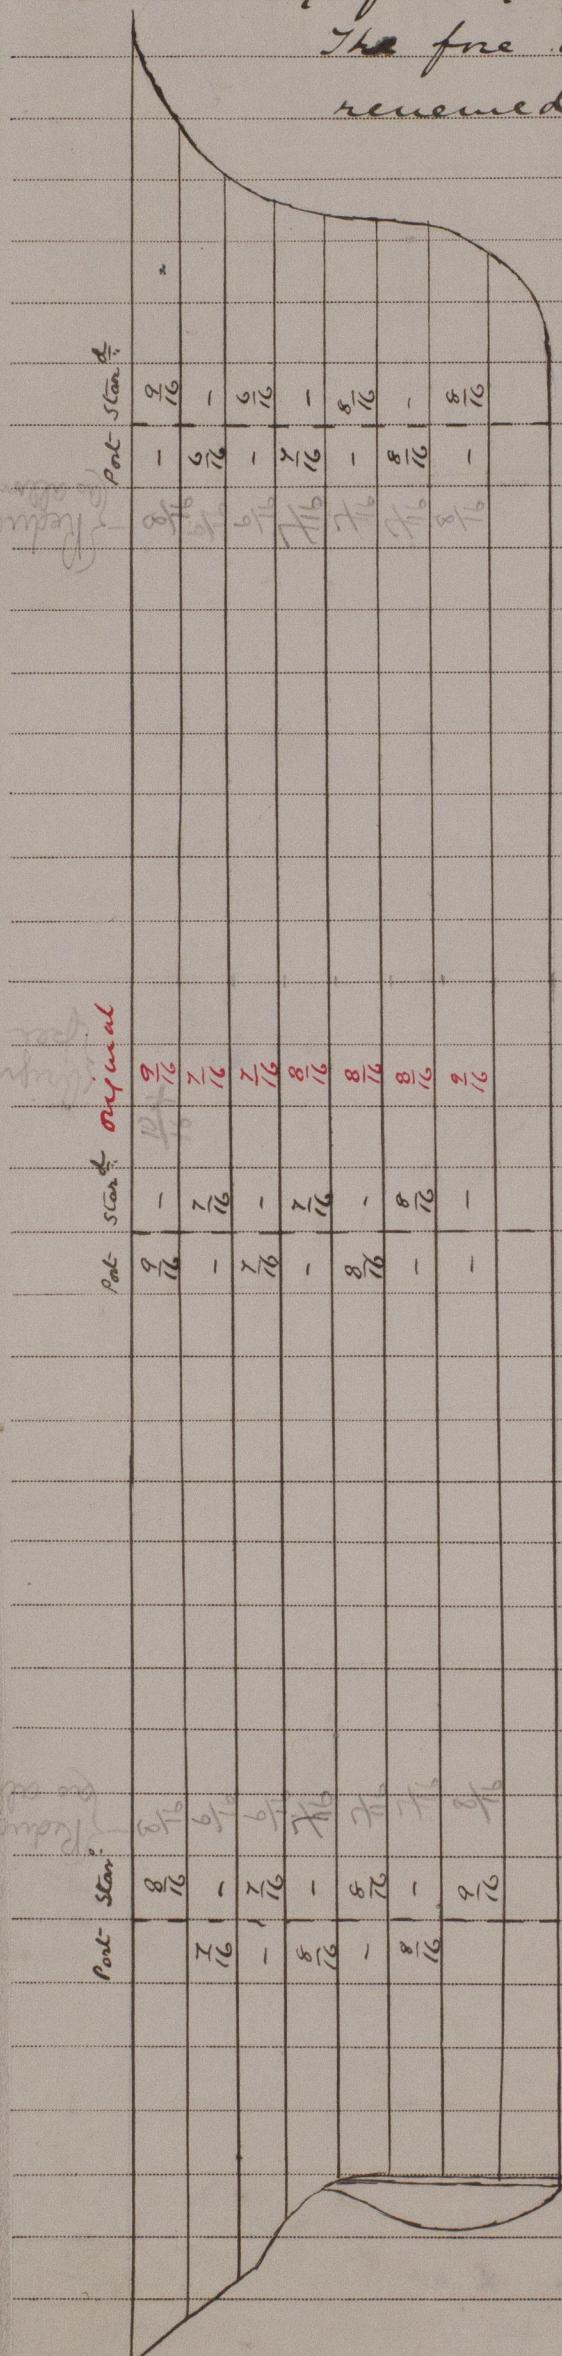

The shell plating drilled in three sections on each side and the chickens found to be as green as sketch herewith.

E. C. Chapman
Wednesday.