

56705 Len

The following repairs were recommended and have now been done viz:-

On account of Wear & Tear:- Decks re-caulked and payed all fore and aft; Rudder braces re-fastened; Bowspirit, Mainmast and Mainboom renewed; Rigging overhauled; all bolts and trenails removed for examination, replaced with new; Pumps overhauled; Hatches repaired where necessary, and outside coated with tar.

On account of Damage stated to have been caused by ice:- One outside plank on starboard bow and one on Port bow renewed, and seams in way of same caulked.

G. W. Cooper
Wm Morrison

N.B.—If this Report is copied by Copying Press, special care must be taken that the copying paper is not so much damped as to spread the ink, or cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.



© 2019

Lloyd's Register
Foundation