

## REPORT of SURVEY for REPAIRS, &amp;c.

e of writing Report 13 Aug 1895 When handed in at Local Office.

18 Port of London

Survey held at London

Date, First Survey 2<sup>nd</sup> Aug 1895 Last Survey 9<sup>th</sup> Aug 1895  
(No. of Visits)

on the Wood, Iron or Steel S.S. "City of London" Master J. Berry

TONNAGE:— Built at Newcastle By whom Schlesinger Davis &amp; Co. When 1891-12

GROSS 351 TONS 262 PORT BELONGING TO London

NET 182 OWNERS' ADDRESS D. C. Thomas &amp; Sons

Owners' Address (if not already recorded in Appendix to Register Book.)

Surveyed Afloat or in Dry Dock? Dry dock Name of Dock Fletcher's Dock Destined Voyage Brussels

B=Cell D=Bor D=Ba tons; uE&amp;B tons; f tons; f tons; tons; tons; tons; t

FPT tons; APT tons; MT tons; MT tons; MT tons; MT

N.B.—All alterations in the existing records should be underlined.

If the vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, etc., and of the inner bottom plating, especially in the boiler space.

Last Survey, No. 5620 Port Law

Particulars of Classification (which must be inserted precisely as in Register Book &amp; Supplements).

CHARACTER. X for Special Survey. Date of last Survey and of Periodical Surveys.

Years A vessel now expired.

Machinery and Boiler Surveys (including date of N.B., if any).

\* 100 A1 1.95 \* LMC-12.91

Society's Freeboard (if assigned) as painted on Ship and now verified ft. 10 1/2 ins.

PAIRS, OR EXAMINATION AS PER RULE, FOR S.S. N°1 - Damage by Ice &amp; Collision.

S.S. N°1:— Vessel placed in dry dock, bottom cleaned, examined found in good condition and recoated with paint.

All holds, peaks and bunkers cleared; ceiling lifted as per Rule all parts of holds, peaks, bunkers, &amp;c. spaces, inside of ballast tank, etc., decks; also masts, spars, shrouds, watertight doors, examined and found or put in good condition.

Ballast tank and hand pumps tested and found satisfactory.

Repairs on account of Wear &amp; Tear:—Holds, peaks and bunkers sealed and caulked, either with paint or cement wash; all defective ceiling renewed; on beam after peak re-riveted at the knees; several bent hold pillars fairied and main rigging overhauled.

Repairs of Damage stated to have been caused by ice: Port bow six (6) dent plates (E.1.2.3; F.1.2.3) taken off fairied and replaced; four (4) indented plates

TYPE OF DAMAGE REPAIRS:—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Other Items:—
Renewed ... .. .	1	✓	✓	✓	✓	One new stringer plate
Fairied or Repaired ...	22 <sup>3</sup>	25 <sup>✓</sup>	25 <sup>✓</sup>	✓	✓	Stringer angles fairied
CONDITON OF THE						
Timbers of Frame at the openings	good					Hatches
Ditto ditto at other places	"					Boats
Keelsons	"					Masts, Yards, &c.
Clamps, Shells & Stringers	"					Condition, how ascertained by examination (State if wedges removed Main only)
Beams & Fastenings	"					Sails
Beams & Fastenings	"					Equipment letter
or Rivets	"					Anchors, No. of 28-15-1K
Beams & Fastenings	"					Cables (state if now ranged) NO
or Rivets	"					length size
or Rivets	"					" Rule-length 165 size 15/6
or Rivets, & Crutches	"					Hawsers & Warps sufficient
or Rivets, & Crutches	"					Standing & Running Rigging good

## General Observations, Opinion as to Class, Recommendation, &amp;c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon survey, thus, for example:—".....to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 9.91," or "to remain as classed and to have record of survey, 9.91, and the notations of No. 1-91 and ptN91, &amp;c."

This vessel is now in a good and efficient condition and eligible in my opinion to remain as classed and to have record of survey 8.95 Lon, and the notation of S.S. Lon N°1-95.

(if chargeable) per Scale II., Sec. 27		£ HULL CERTIFICATE WRITTEN	Fees applied for,
£ (per Section 28)	£ 3 : 0 : 0		15 <sup>th</sup> Aug 1895
Damage or Repair Fee (if any) See 28.) less 10%.	£ 3 : 3 : 0		
Expenses (if chargeable)	£ 6 : 12 : 8		
Surveyor's Fee (if any)	£ 6 : 11 : 0		

Committee's Minute

Character assigned

+ LMC 8.95 n. No. 1-95

TUES 20 AUG 1895

100A1

L

Lloyd's Register Foundation

LON706-0195 2

## S.S. City of London

plates (D.1, E.5, F.4, G.1) fair'd in place; sixteen frames & reverse frames fair'd in place. Starboard bow:- Eight (8) indented plates (E.1.2.3.4, F.1.2.3.4) taken off fair'd and replaced; one (1) indented plate (D.1) fair'd in place; sixteen (16) bent frames and reverse frames fair'd in place; chain cables and spar ceiling in way of damage removed to facilitate repairs and replaced and repairs coated with paint.

Repairs on account of Damage stated to have been caused by collision with the S.S. "Fiducia" on the 1<sup>st</sup> August 1895:-

On port side abreast of engine room, one indented R. & deck side plate fair'd in place; one sheerstrake plate taken off, fair'd and replaced; one plate in strake below sheerstrake found broken and renewed, one indented plate in this strake fair'd in place one indented plate in <sup>2<sup>nd</sup> strake below sheerstrake taken off, fair'd, and replaced; 3 bent frames and reverse frames fair'd in place; angles of side stringer (one length of each) removed, one buckled stringer plate renewed and angles fair'd and replaced; coal in port side bunker, engine room platform on port side, oil tanks, four discharge chests, and main injection chest removed to facilitate repairs and all replaced, and repairs coated with paint.</sup>

W<sup>m</sup> Morrison