

Lloyds Register of British
and Foreign Shipping.

Prory Road Milford Haven

LLOYDS' REGISTER,

LONDON.

9th December 1891

RECR 10 DEC. 91

ANSR 10.

Sir

I went on board the Windermere after she was moored yesterday also this morn'g for the purpose of seeing what damage she has sustained by striking the dock head while entering yesterday. As they have no stage rig'd and cannot rig one very well as they are going to run her and put her in to dry dock today I cannot see the outside damage but from what I see inside two of the shell plates will have to come off and be reset. She has taken the Pier right on the collision Bulkhead and stoned it in about 6" setting in one frame forward and one frame aft about 2 to 3 inches the two frame angles on Bulkhead are drove straight in and broken from inner edge of web to rivet hole the plate itself drove into an S the horizontal bar is buckled but with the exception of the two frame angles there is no sign of any other break. I cannot make out my report untill I see the outside With the frame angles on bulkhead I intend

to let one of them remain will have it set back into place and a cover angle put over the break the one on the other side might be done the same thing with if we can get it out properly if not it must be cut out at a fair shifting and two cover angles put on Will you kindly give me your advice on this at the back I give a rough sketch of Balkhead
I am, Sir,

your obedient Servant
A.D. Allan

The Secretary
London



©2021

Lloyd's Register
Foundation

A.G.H
10/12/91

S. Winderhouse
Ph's unfortunate
that Mr. Allen be
informed the owner
has a right when
the ship went into
the same state as
before the damage
before 1/2m

10/12/91
Ans. 10th 1/2m

I have drawn the
frame angle straight
it ought to be bent as ticked
in but its nearly to shore the
break. it is not past the
rivet hole and I think if it went well back
to place it would be better than cutting out

O add



© 2021

Lloyd's Register
Foundation