



REPAIRS.

MACHY.

All thrust collars remetalled.  
 No. 1 Main bearing (top half) remetalled.  
 Air & Circ<sup>g</sup> pump rods dressed up and rebushed.  
 Main Condenser, tubes renewed as required, and tested.  
 Aux<sup>y</sup> Condenser retubed throughout.  
 Screw shaft changed, Paw shaft marked  
 Stern bush renewed and rewooded.

26574 1887  
 B. L. 3-9-15  
 LLOYD'S J.W.G.

BOILERS.

All boiler mountings overhauled and placed in a safe working condition.  
 Five lengths of main steam pipe examined and tested hydraulically after annealing (15 Kg/cm<sup>2</sup>).  
 Defective combustion chamber stays renewed as required.  
 10 Smoke tubes renewed in Centre boiler  
 Three furnaces jacked up viz Centre furnace, Port Ble  
 Port " Star<sup>a</sup>  
 Centre " Star<sup>a</sup>  
 Sundry minor repairs.

This survey was held jointly with an exclusive officer of the Registro Italiano and the fees have been divided equally between the two societies.

J.W.

N.B.—If this Report is copied by copying Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THE MARGIN.

Reclassification survey completed.

If submitted that this vessel is eligible for THE RECORD.

H.M.C. 6:29  
 M.S. 5:29  
 P.T.

NEW.  
 S. 6. 24.

15/7/74

Reinstated machinery  
 put in condition as before.



© 2019

Lloyd's Register Foundation