

of FIUME

30th December 1924.

M.BONIVENTO & OZGOVIC.

the Owners attend on board the wood sailing with auxiliary motor
S/S "SAVA" ex "JELKA" 147.61 tons gross. of BAKAR on the
3rd December 1924 for the purpose of ascertaining the nature and
extent of the Damage stated to have been sustained in consequence
of bad weather grounding on the 25th June 1924 by Vale JURINCICA
and Motor explosion on the 26th June 1924.-

For further particulars please see vessel's Log Book.

On examination of the vessel on the pontoon of Cantiere Navale del
Isturnero in FIUME, the undersigned found the following damage, and
made the accompanying recommendations:-

POUN D.

THIS IS TO CERTIFY THAT THE VESSEL IS IN A FIT STATE FOR SEA SERVICE

R E C O M M E N D A T I O N S .

THIS IS TO CERTIFY THAT THE RECOMMENDATIONS ARE IN ACCORDANCE WITH THE REQUIREMENTS OF THE CLASSIFICATION SOCIETY

STARBOARD SIDE :

Strake C plate No.3 from aft slightly indented.	To be faired in place.
Strake D plate No.3 from aft slightly indented.	To be faired in place.
Strake C plate No.3 from stem slightly indented.	To be faired in place.
Strake D plate No.3 from stem slightly indented.	To be faired in place.

P O U N D.

R E C O M M E N D E D.

Port and starboard side about
250 rivets slack in some po-
sition.

To be renewed.

In Engine space one deck beam
broken and bend.

One deck beam to be renewed.

Engine casings in machinery
spaces several rivets trough
beam broken and plates bend
on the edges.

Broken rivets to be renewed, and plates
to faired in place.

BOATS :

Stem broken. To be renewed.

Main rail broken. To be renewed.

All disturbed work in way of damage to be replaced and made good
in order to render the vessel's condition the same as it was prior to
the alleged damage being sustained.

E N G I N E.

Motor examined and found the following damage and made the accom-
panying recommendations:

P O U N D.

R E C O M M E N D E D.

Cylinder broken.

Piston broken.

Piston rods. broken.

Connectings rods. broken.

Motor to be removed and new water
to be fitted.-

Bearing broken.

First silencer partly broken.

Charter partly broken.

Second Silencer good.

Main shaft "

Well "

Lubricator "

Pumps "

All the above recommendation of Hull has been now made to Surveyor sa-

satisfactory except the Engine beam and casing plate this will be
made at Spalato on completion of Survey.

New motor has been fitted examined as rules requirements
and found in order.

Fee	Ital. Lire 650.-
Spec.att.	" 300.-
Expenses	" 300.-
Total	Lire = 1250.-

*Longue
M. G. P. S. P.
Spalato*



© 2020

Lloyd's Register
Foundation