

REPORT OF SURVEY FOR REPAIRS, &c.

Report of writing Report 19th July 1941 When handed in at Local Office 20th July 1941 Port of Milford Haven
Survey held at Dale Rds Milford Haven Date, First Survey 16th July Last Survey 19th 1941
Book. (No. of Visits 3)

645 on the Wood, Iron or Steel &c Steamer "Porthmeor"

TONNAGE:- Built at Barnstaple By whom Taw Shipyard Ltd When 1923 - 2
ROSS 449 Owners Richard England SS. Ltd Owners' Address Cardiff
UNDER DECK 226 Managers R. P. Gore & Co Ltd (if not already recorded in Appendix to Register Book).
ET 188 Port belonging to

Surveyed Afloat or in Dry Dock? Afloat Name of Dock Dale Rds + Milford Haven Destined Voyage Barry

LD Bor DBa feet; uE&B feet; f feet
al capacity tons. FPT tons; APT tons; MT feet tons.

Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

1st Report, No. 53774 Port CFF.

Medical Surveys, when held, must be reported in detail and serially in the terms of the Rules and items remaining to complete the Surveys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.

Damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

not required

Was a damage report made by anyone else? if so, by whom?

PAIRS, OR EXAMINATION AS PER RULE, FOR Damage by Enemy action at 3.15 AM of the 5th July/41 40° S.E. of Bishop Light whilst on a passage from Dublin to Barry

On examination of vessel whilst afloat in Dale Roads found:-

After Saloon bulkhead Vertical plate No 3 from SW side pierced by bomb leaving hole 30 ins diam also rupturing deck connections & setting down deck plate in way leaving hole 15 ins x 3 ins open to A.Hold Carried away Teak side board. Dining table before piercing the Fore Bulkhead No 4 Vertical plate from SW leaving similar opening; then ricochet to No 1 Hatch after coaming, bending back plate & hatch rest bar. SW steering Gear lead from deck to Wheelhouse carried away & 2 Port lights in Fore Saloon bulkhead renewed. Winch steam pipe to No 2 winch fractured at flange & Exhaust pipe flattened out in way of damage. Permanent repairs made to Steam & Exhaust pipes & Steering Gear lead. Satisfactory temporary repairs (over)

SUMMARY OF DAMAGE REPAIRS:-	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items:-
Renewed								
Removed and Faird or Repaired								
Faird or Repaired in place								

PRESENT CONDITION OF THE

ks	Bulkheads	Engine Room Skylights	Copper, or Y.M. (State if on Fett.)
lking of Decks	Ceiling	Coal Bunkers, Openings, Covers, &c.	When fitted, Month Year
minings	Cement or Asphalt	Oil Bunkers	Boats
ms & Fastenings	Rudder	Scuppers	Masts, Yards, &c.
side Plating	Steering gear and its connections	Cargo Hatchways	Condition, how ascertained (State if wedges removed.)
" " in way of sidelights	Windlass	Hatches	Equipment letter
mes	Have pumps been examined and found efficient?	Planking	Anchors, No. of
erse Frames	Have Sluice Valves been examined and found efficient?	Caulking	Cables (State if now ranged)
gitudinals	Have Watertight Doors been examined and found efficient?	Treenails	" length (on board) mean diamr.
nsverses	Have Ventilators and their Coamings been examined and found efficient?	Breasthooks & Stemson	" Rule length size
ors	Air and Sounding Pipes	Transoms Pointers & Crutches	Chain Locker
lsons	Doubling Plates under Sounding Pipes	Timbers of Frame at openings	Hawsers & Warps
ingers		" " at other places	Standing and Running Rigging
er Bottom Plating		Stringers, Clamps & Shelves	Sails
ve the Tanks been examined internally?		Salting (State if examined.)	
ve the Tanks been tested?			

General Observations, Opinion as to Class, Recommendation, &c.:- The vessel as far

State any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey. Example:- "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey," "to be classed and to have record of survey, 1,38, and the notations of ss No. 1-38."

as now seen is in my opinion eligible to remain as now classed in Register Book without fresh record of survey subject to vessel having permanent repairs made at first opportunity

Survey Fee (per Section 20)	£	:	:	Fees applied for, 19 th July 1941
Special Damage or Repair Fee (if any) (per Sec. 20)	£	3	3	0
Travelling Expenses (if chargeable)	£	:	:	Received by me, 21 st July 1941
Second Surveyor's Fee (if any)	£	:	:	

Committee's Minute

Character Assigned

FRI. 15 AUG 1941

As now Subject of

J. R. Douglas
Surveyor to Lloyd's Register of Shipping.



© 2020

Lloyd's Register Foundation

W113 - 0004

the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

THE SURVEYORS ARE REQUESTED NOT TO WRITE ACROSS THIS MARGIN.

N.B.—If this Report is copied by Copying Press, especial care must be taken that

If Stockless, state Mechanical Test.

If Stockless, state Mechanical Test.

4

五

五

© 2020

Lloyd's Register
Foundation