

5m.10.38.

10 JAN 1941

Received by Chief Ship Surveyor

Received from Chief Ship Surveyor

VESSEL'S NAME "MEANDROS" Rpt. Bry No. 24460

The remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

(The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement.—Extract from Sub-Committee's Report, 24/5/32.)

The class is subject to indented shell plates F.5 (p.s) and B.1 and E.1 (s.s) being dealt with at the Owners' convenience, to temporary repairs to No. 2 shell plate from aft in 6th strake below sheer being specially examined at the next dry docking, and to a new anchor of requisite weight and test being supplied at the first opportunity.

The BARRY Surveyors report the vessel placed in dry dock, the bottom coated and minor repairs effected.

No. 2 plate from aft in 6th strake below sheerstrake (p.s), as above and No. 4 plate in 4th strake below sheerstrake (s.s), found fractured, repaired by electric welding and reinforced by fitting electrically welded doubling plates.

No. 6 plate in 4th strake below sheerstrake and Nos. 8 and 9 plates in 3rd strake below sheerstrake (s.s) and Nos. 8, 11 and 13 in 3rd strake below sheerstrake (p.s), also found to have small fractures, have been repaired by electric welding.

The Surveyors recommend these electric welding repairs to shell plates on port and starboard sides be specially examined at next dry docking.

It is submitted the vessel appears worthy to remain as classed with record of survey 12.40, subject as recommended and as above.

100A1 } Subject, etc.  
12.40 Bry }

The Certificate of Classification to be endorsed "Cargo battens not fitted" and the same to be printed in the Register Book.

S.R.L. Amend as regards No 2 plate from aft in 6th strake below sheer p.s.

Handwritten signature and date 9.1.41



© 2020

Lloyd's Register Foundation

W1146-0052

and shell plates... Fees applied for... and new bower anchor...