

COPY.

Lloyd's Register of Shipping.



Port LONDON,

14th August, 1942

This is to Certify that

WILLIAM ERNEST WRAY AND ALEX M. JENKINS,

the undersigned Surveyor to this Society did at the request of the Owners attend on board the steel screw steamer "CHULMLEIGH" 5445 tons gross of London, whilst the vessel was in Millwall Dry Dock, London, on the 27th July, 1942, for the purpose of ascertaining the nature and extent of damage stated to have been caused by ice in the Archangel River between 9th and 23rd December, 1941.

On examination it was found and recommended as follows:-

FOUND

Shell plating plates numbered
from aft portside

RECOMMENDED

"G" strake 16, 17 & 18 indented
between frames

Three plates be removed faired
and refitted.

"H" strake 15, 16, 17 & 18
indented between frames

Four plates be removed faired
and refitted.

"J" strake 8 and 11 indented
between the frames

Two plates be faired in place

"J" strake 18 indented between
the frames

One plate be removed, faired
and refitted.

Starboard side

"G" strake 17 & 18 indented
between the frames

Two plates be removed, faired
and refitted.

"H" strake 16, 17 & 18 indented
between the frames

Three plates be removed, faired
and refitted

"J" strake 5 indented between
the frames

One plate be faired in place

"J" strake 6 indented between
the frames

One plate be removed, faired
and refitted.

It is also recommended that all cargo battens and fittings removed to effect or facilitate the foregoing repairs be replaced as before, all disturbed work coated outside and inside as before, and the whole of the work be carried out so as to place the vessel in as good a condition as obtained before the alleged casualty was sustained.

W. E. Wray for Self and Alex Jenkins.

Fee:- £5.5.0

Surveyors to Lloyd's Register of Shipping.

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:-
"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."