


PLATES IN DK HOUSE
REMOVED FOR WASTAGE

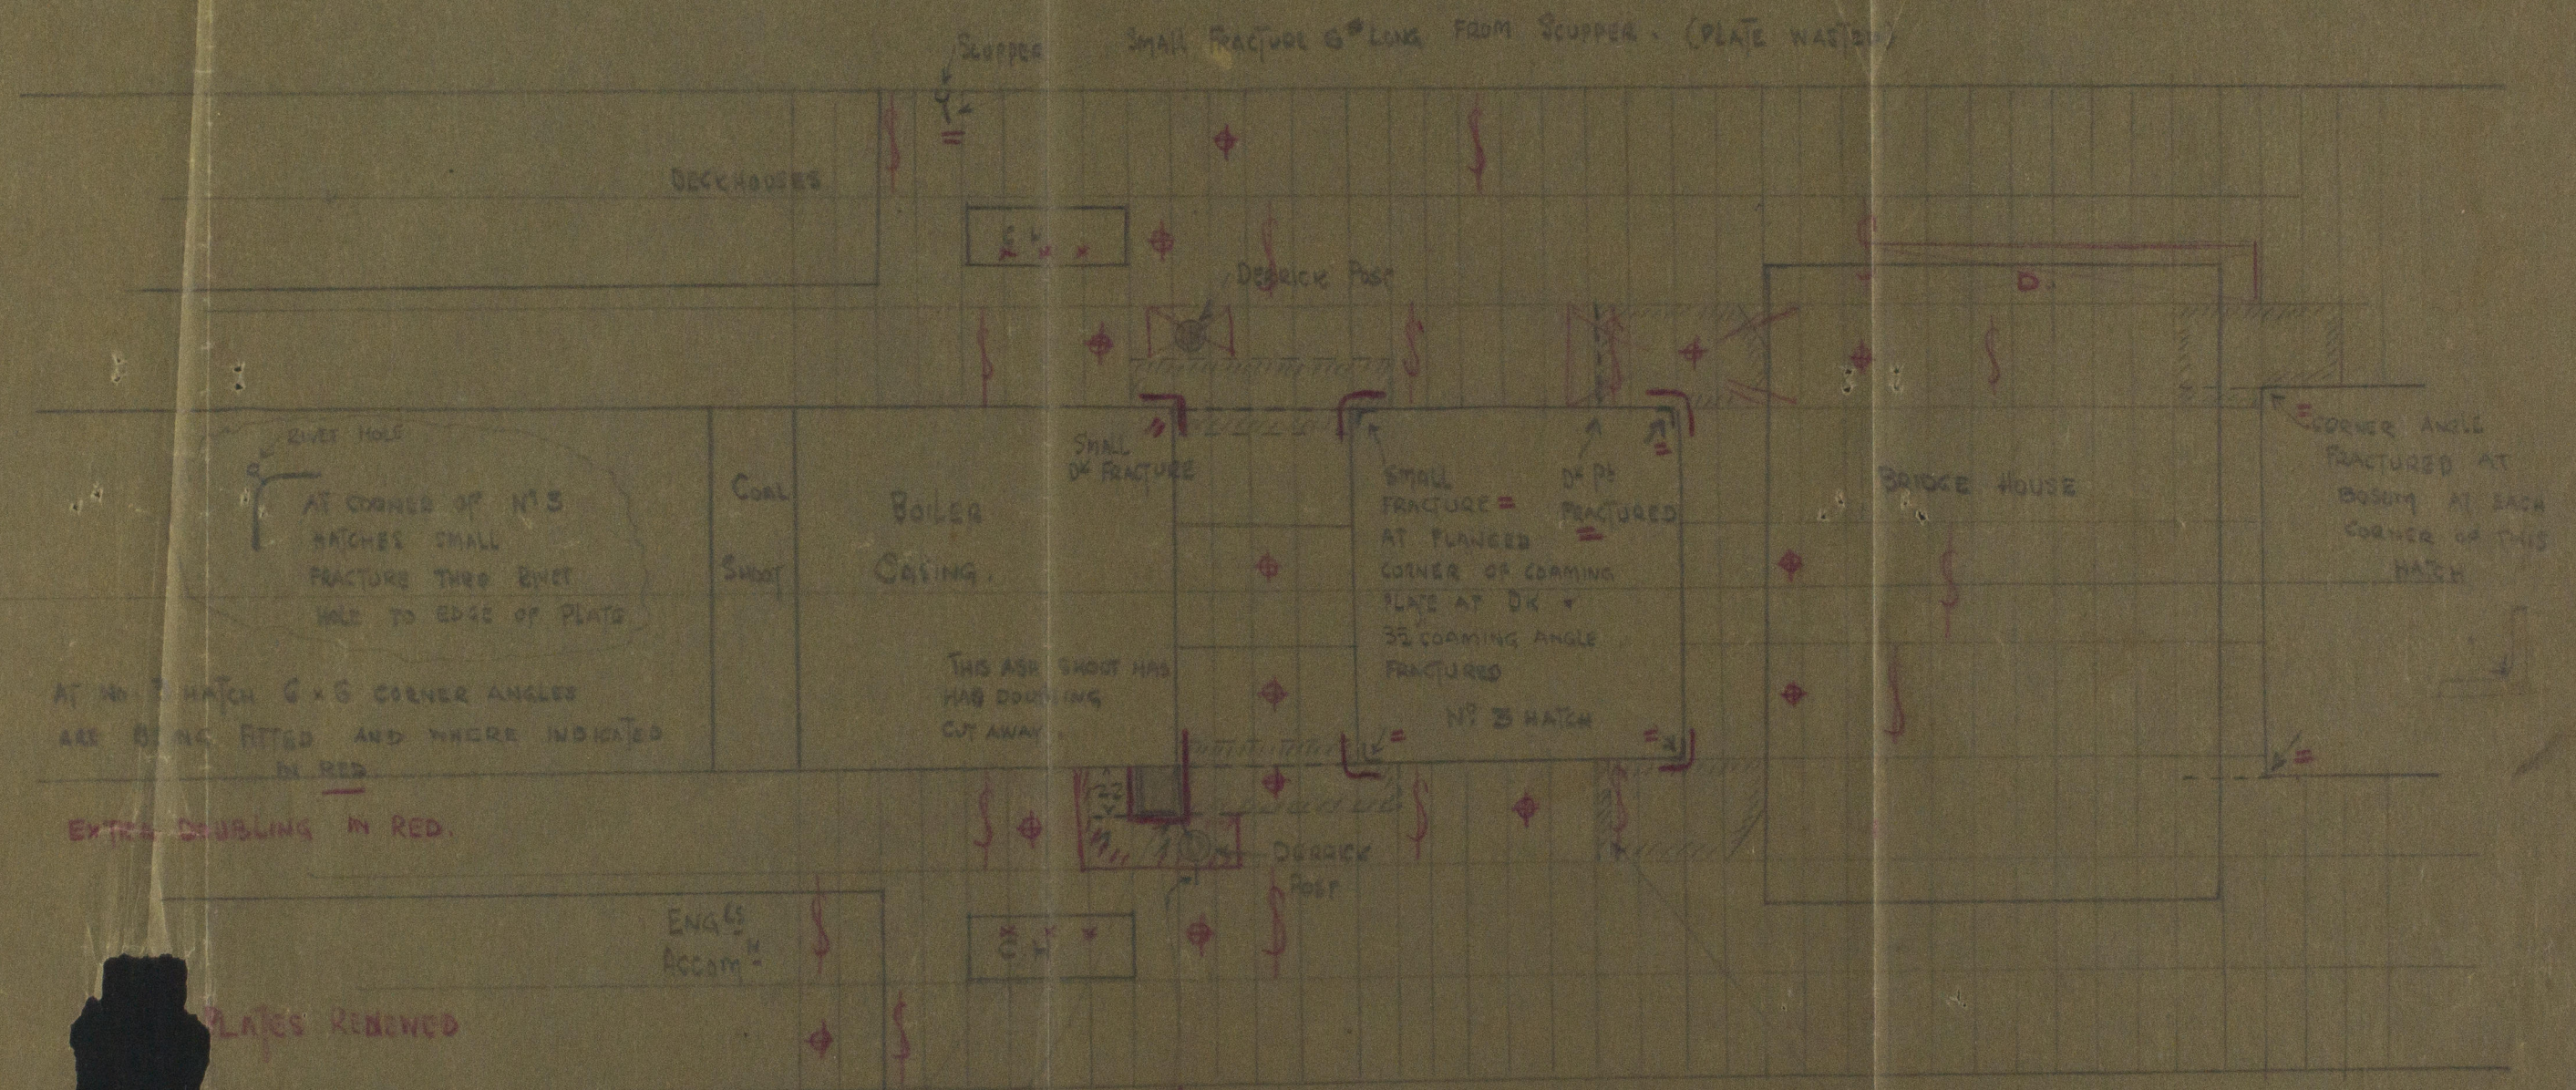

RIVET HOLE
AT CORNER OF NO 3
HATCHES SMALL
FRACTURE TWO RIVET
HOLE TO EDGE OF PLATE

AT NO 3 HATCH 6x6 CORNER ANGLES
ARE BEING FITTED AND WHERE INDICATED
IN RED


EXTRA DOUBLING IN RED.

THIS ASH SHOOT HAS
HAB DOUBLING
CUT AWAY

SMALL
FRACTURE =
AT PLANGED
CORNER OF COAMING
PLATE AT DK +
35 COAMING ANGLE
FRACTURED

CORNER ANGLE
FRACTURED AT
BOSOM AT EACH
CORNER OF THIS
HATCH

PLATES REMOVED

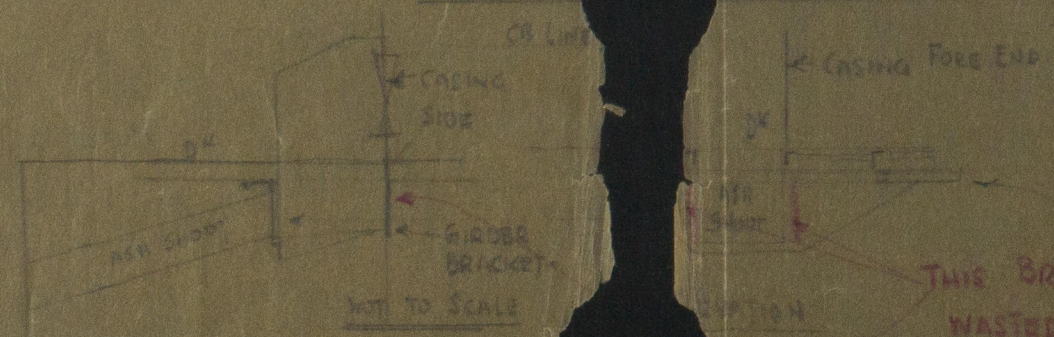

THIS BRACKET WAS
WASTED AWAY AT ASH SHOOT AND IN EFFECTIVE.

12" PLATING
BETWEEN SHOOT
AND OPENING
FOR POST

B.A. GIRDER ANGLE UNDER BEAMS

102
FRACTURE FROM CORNER OF
ASH SHOOT OPENING TO DERRICK
POST AND ACROSS PLATE TO 6" INTO
ADJOINING STRAKE. FRACTURE TWO
RIVET HOLES IN DECK RING (28" DIA)

BEAM AT 102 WASTED AWAY AT ASH SHOOT.

THIS PLATE HAS
FRACTURES ON SHELTER DK
HAD A DOUBLING
FITTED COVERING
PREVIOUS FRACTURE

1173 - 0151