

of writing Report *July 17* 191*8* When handed in at Local Office *July 18* 191*8* Port of *Montreal*

Survey held at Lucas, P. I. Date, First Survey June 28 Last Survey July 4, 1918
(No. of Visits 4)

118 on the Wood, Iron or Steel *S. S. / ROJA* Master *G. Hennick*
 MONTH. YEAR. MONTH.

TONNAGE:-
ROSS 2715
Built at Monrovia, C.M. By whom Iron Works When 1918
Owners Gold Beach Co. Y. Lakes Trav. Co. Port belonging to Iron beach

OWNER DK. 2264
1663
Owners' Address

Surveyed Afloat or in Dry Dock? *Both* Name of Dock *New Govt. Dock* Lewis. Destined Voyage *Sydney N.S.W.*

<i>B=CellDBorDBa</i>	<i>feet; uE&B</i>	<i>feet; f</i>	<i>feet;</i>	Particulars of Classification (which must be inserted <u>precisely</u> as in Register Book & Supplements).
<i>tal capacity</i>	<i>tons. FPT</i>	<i>tons; APT</i>	<i>tons; MT</i>	

<p>N.B.—All alterations in the existing records should be <u>underlined</u>.</p> <p>If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, and bulkheads, and the amount of corrosion in the boiler plates.</p>		<p>CHARACTER.</p> <p>* For Special Survey.</p> <p>Date of last Survey and of Periodical Surveys.</p>		<p>Years since last Survey.</p> <p>Years since last Survey.</p> <p>Years since last Survey.</p>	<p>Machinery and Boiler Surveys.</p> <p>(including date of N.B., if any).</p>
--	--	--	--	---	---

ast Report, No. Port

Periodical Surveys, when held, must be reported in detail and serialim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs consequent on Damage (the cause of which must be stated) should be separated from Repairs due to other causes;

and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the placement of Anchors or Chains is reported, the particulars should be clearly stated in the space provided on back of this form. State also the dates and initials of any letters respecting this case. ft. in

damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and where.

They were declined? Copy attached. Was a damage report made by anyone else? If so, by whom? Capt. Cook for undercarriage

PAIRS, OR EXAMINATION AS PER RULE, FOR *Damage States Insured during Launching of vessel.*
See same. On the Starboard side

E Spake No. 5. plate removed & laid

No. 6.

No. 7.

с. 8.

No. 9 - removed
No. 10 - lived in place

Floors Nos 51-52-53-54-55-56-57-58-59-60-61-62-63-64-65-66-70-75 Faired in place

" Nos 50-63-67-68-69-71-72-73-74. Removed & failed

P.T.O.

MARY OF DAMAGE REPAIRS :—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items :—
Renewed	1	2						
Removed and Faired or Repaired	4	14		9				
	1	10		18				

Faired or Repaired in place		Good		Bad		Fair		Poor	
SENT CONDITION OF THE		Stringers		Dblng. Plates under Sounding Pipes		Copper, or Y.M. of Wood Vessels			
s		Inner Bottom Plating		Engine Room Skylights		(State if on Felt.)			
king of Decks		State if Tanks have been examined inside		Coal Bunkers, Open'gs, Lids, &c.		When put on, Month		Year	
rways		State if Tanks now tested		Scuppers		Boats		Good	
ings		Bulkheads		Cargo Hatchways		Masts, Yards, &c.			
ns & Fastenings		Ceiling		Hatches		Condition, how ascertained		From Deck	
ide Plating		Cement or Asphalt		Planking of Wood Vessels		(State if wedges removed)		No	
king of ditto		(State which.)		Oakling ditto		Sails		Yes	
ts		Rudder		Treennails ditto		Equipment letter			
sthooks & Crutches		Steering gear and its connections		Breasthooks & Stemson ditto		Anchors, No. of		BB 15 1K	
soms		Windlass		Transoms, Pointers, & Crutches ditto		Cables (State if now ranged)		No	
nes		Have Pumps now been examined and found efficient?		Timbers of Frame at openings ditto		" length		size	
rse Frames		Have Sluice Valves now been examined and found efficient?		Ditto ditto at other places ditto		" Rule length		size	
rs		Have Watertight Doors now been examined and found		Stringers, Clamps & Shells ditto		Hawser & Warps		Good	
				Selling ditto		St. Line & Russian Ropes		"	

general Observations, Opinion as to Class, Recommendation, &c.:

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—“.....to remain as now classed in the Register Book *without fresh record of Survey*,” “to remain as classed and to have record of

This vessel so far as seen is now in good and efficient condition eligible in my opinion to be classed as recommended in Toronto F. C. report and to have record of Survey 7-18

Pay Fee (per Section 28) \$: Fees applied for, July 17, 1928
 Total Damage or Repair Fee (if any) \$ 1.50.00 : R. J. Alderson

Received by me, 12/9/18 12/9

and Surveyor's Fee (if any) £ : : Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Character Assigned Good

W1251-0180

This image shows a blank, aged, cream-colored page, likely an endpaper or flyleaf of a book. The paper has a slightly textured appearance with some minor creases and discoloration, characteristic of old paper. The left edge of the page is bound, showing the stitching and the inner cover material. There is no text or other markings on the page.

Frans

Nos 67-72 Renewed

No. 50-58-59-60-61-62-63-68-69-70-71-73-74-75 Removed and fixed

Nos 51-52-53-54-55-56-57-64-65-66. Fixed in place.

The frames where cut were joined with an efficient bosom piece

The floors where crapped were joined with double rivetted double butt straps.

All joints in frames & floors where adjacent were well staggered.

On completion of the repairs Tanks Nos-2, 3-4 & 5 were tested according to the rules and found ~~ok~~ made right.

The vessel was placed in Dry Dock for the carrying out of the above repairs. The bottom was examined together with the muller and found in order.

The bottom was recoated up to bottom of the foot-kipping.

The following work was carried out for completion of F.C.

One rivet hole plugged in tunnel.

Starboard forward steering gear lead was moved aft about five inches for better alignment of the chain.

Mr. J. A.

When Anchors or Cables are supplied, the particulars are to be reported in the following form:—

ANCHORS.

Number of Certificate.	Anchors.*	WEIGHT, BY STOCK.			WEIGHT OF STOCK.			TEST, PER CERTIFICATE.			WEIGHT REQUIRED by TABLE 30 or S1.			Description of Anchor.	Makers.	Where and when tested Superintendent.
		Cwts.	qrs.	lbs.	Cwts.	qrs.	lbs.	Tons.	Cwts.	qrs.	lbs.	Cwts.	qrs.			
	1st Bower ...															
	2nd "															
	3rd "															
	Collective Weight.															
	Stream															
	Kedge.....															

* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

CHAIN CABLES.

[illegible]