

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report 6th Feb 1937 When handed in at Local Office 6th Feb 1937 Port of NEWCASTLE-ON-TYNENo. in
Reg. Book.Survey held at Wallsend-on-TyneDate, First Survey 6th Jan 1937Last Survey 19th Jan 193783279 on the Wood, Iron, or Steel"San Florentino"

(No. of Visits

19.)

TONNAGE:-

GROSS 12842UNDER DK. 12353NET 8107Built at NewcastleBy whom Swan Hunter & WighamWhen 1919

MONTH.

Owners Eagle Oil & Shipping Co Ltd

Owners' Address

(If not already recorded in Appendix to Register Book).

Managers

Port belonging to LondonSurveyed Afloat or in Dry Dock? Dry Dock Name of Dock Swan Hunter Destined Voyage ✓WB=CellDBorDBa feet; uE&B feet; f feet
total capacity tons. FPT tons; APT tons; MT feet tons.N.B.—All alterations in the existing records should be underlined.
If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.Last Report, No. 8940 Port Port B. Co.

(Periodical Surveys, when held, must be reported in detail and seriatim in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. State also the dates and initials of any letters respecting this case.)

In damage cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined

Supt. Not requiredWas a damage report made by anyone else? If so, by whom? Underwriters SurveyorsSociety's Freeboard (if assigned) as painted on Ship and now verified ✓ ft. ✓ ins.REPAIRS, OR EXAMINATION AS PER RULE, FOR Damage stated to have been sustained by heavy weather between 19th Sept 1936 and 2nd Jan 1937 on voyage Caracas to Tyne.How Done:—Vessel placed in dry dock, bottom & rudder cleaned, examined & recoated. All cargo tanks, summer tanks, cofferdams, fore deep tank, fore & aft peak tanks, boiler room tank tested.

Caulking & riveting of bulkheads & shell overhauled. About 6,600 internal rivets and 2800 shell rivets renewed.

Shell plate T2 starboard side forward found fractured now renewed.

Shell plate F10 port side between Nos 7 & 8 cargo tanks found fractured. The fracture was satisfactorily welded & doubling plate fitted on top.

Rudder lifted & adjusted. A number of minor repairs effected.

SUMMARY OF DAMAGE REPAIRS:—

	Shell Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:—
Renewed	1							1 doubling plate fitted
Removed and Faired or Repaired								
Faired or Repaired in place								

PRESENT CONDITION OF THE

	State if Tanks have been examined inside	Air and Sounding Pipes	Copper, or Y.M. of Wood Vessels
Decks	generally end	✓	(State if on Felt)
Caulking of Decks	as stated	✓	When put on, Month Year
Coamings	✓	✓	Boats
Beams & Fastenings	✓	✓	Masts, Yards, &c.
Outside Plating	✓	✓	Condition, how ascertained
in way of sidelights	✓	✓	(State if wedges removed)
Breasthooks	✓	✓	Sails
Transoms	✓	✓	Equipment letter
Frames	✓	✓	Anchors, No. of
Reverse Frames	✓	✓	Chain Locker
Longitudinals	✓	✓	Cables (State if now ranged)
Transverses	✓	✓	length (on board) mean diamr.
Floors	✓	✓	Rule length size
Keelsons	✓	✓	Hawser & Warps
Stringers	✓	✓	Standing and Running Rigging
Inner Bottom Plating	✓	✓	

General Observations, Opinion as to Class, Recommendation, &c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:— "to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,24," or "to remain as classed and to have record of survey, 1,24, and the notations of ss No. 1-24 and PTND24, &c."

This vessel is eligible, in my opinion, to remain as classed and have record of survey 1.34.

Survey Fee (per Section 20) £

Special Damage or Repair Fee (if any) £ 26 : 5 : -

Travelling Expenses (if chargeable) £

Second Surveyor's Fee (if any) £

Fees applied for,

6 FEB 1937

Received by me,

27.2.37

1937

Surveyor to Lloyd's Register of Shipping.

Committee's Minute

Character Assigned Su Tac 9105Lloyd's Register
Foundation

UK128-0105